

Circuit Change

PROBLEM: *The standby transformer voltage is dropping or unit won't turn on from standby mode.*

CAUSE: *Capacitors C511,C512 and C513 are shorting.*

SOLUTION: *Change C511,C512 and C513 from 100nF/100v ceramic disc to 100nF/100v metallized polyester film.*

PRODUCTION:

This change has been implemented in production from serial number:H1YC35017612

Contact:

**NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
www.nadelectronics.com**