

NAD

Service Hint

for C521/C541 ,C520/C540 , C522/C524

If the cd player has a complaint of not able to play a cdr or out of tolerance discs ,try replacing these capacitors with the following values. This will also provide a cure on some players for “NO DISC” message.

C520/C521 /C522/C524

C122 is changed to 2.7pF

C123 is changed to 0.01uF

C124 is changed to 22pF

C540/C541

C122 is changed to 2.7pF

C123 is changed to 0.01uF

C124 is changed to 22pF

C311 is changed to 220pF

Production:

This change has been implemented in production from serial number: G19C52113901 - C521/C
G19C54108101 – C541/AH
G19C54108401 – C541/C

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
www.nadelectronics.com