



## *Service Hint*

*for C521/C541 ,C520/C540 , C522/C524*

---

---

*If the cd player has a complaint of not able to play a cdr or out of tolerance discs ,try replacing these capacitors with the following values. This will also provide a cure on some players for “NO DISC” message.*

### *C520/C521 /C522/C524*

*C122 is changed to 2.7pF*

*C123 is changed to 0.01uF*

*C124 is changed to 22pF*

### *C540/C541*

*C122 is changed to 2.7pF*

*C123 is changed to 0.01uF*

*C124 is changed to 22pF*

*C311 is changed to 220pF*

### **Production:**

This change has been implemented in production from serial number: G19C52113901 - C521/C  
G19C54108101 – C541/AH  
G19C54108401 – C541/C

### **Contact:**

**NAD Electronics International**  
633 Granite Court  
Pickering, ON Canada L1K 3K1  
Voice: 905-831-0799 FAX 905-837-6357  
[www.nadelectronics.com](http://www.nadelectronics.com)