Service Information C660

Circuit Change

PROBLEM: You may receive the complaint, connecting a source like another CD player, etc via a digital input the signal will not lock and no sound will be recorded.

CAUSE: The capacitor C771 47pF is distorting the digital signal.

SOLUTION: Remove capacitor C771 and test digital input.

Contact:

NA

NAD Electronics International 633 Granite Court Pickering, ON Canada L1K 3K1 Voice: 905-831-0799 FAX 905-837-6357 www.nadelectronics.com