

---

## Headphone circuit change

---

*PROBLEM: Left and right channels on headphone output are reversed.*

---

*CAUSE: PCB traces are reversed to the headphone jack.*

---

*SOLUTION: Reverse left and right signal path to headphone socket .*

*Refer to Diagram 1 for modification. On the PCB for the headphone socket , connector PN511, remove the wires pin 1 (Red wire left ch.) and pin 3 (White wire right ch.) from the connector and reverse their positions when inserting wires back into connector.*

---

### *PRODUCTION:*

This change has been implemented in production from serial number: L15C660100001.

---

### **Contact:**

**NAD Electronics International**  
**633 Granite Court**  
**Pickering, ON Canada L1K 3K1**  
**Voice: 905-831-0799 FAX 905-837-6357**  
**NAD@www.NADelectronics.com**

# C660 HEADPHONE SOCKET WIRING DIAGRAM

## DIAGRAM 1

