



Signal display circuit change

PROBLEM: Poor sensitivity of the signal strength bar graph.

CAUSE: The polarity of capacitor(C739 10uF/16Vor 25V)and the pcb marking is reversed on the board.

SOLUTION: Invert cpacitor(C739 10 uF/16V or 25V) by connecting its negative lead to ground and the positive lead to pin 12 of U701.

PRODUCTION:

This modification has been implemented in production from serial number:G13L4013553

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
NAD@www.NADelectronics.com