


Circuit Change

PROBLEM: *When using the component out on the L70 you may find the video signal has faint diagonal lines appearing.*

CAUSE: *The ground plane requires additional coupling.*

SOLUTION: *Add a 10 ohm resistor to location R593 on the video board. Add a 0.1uF ceramic capacitor to location C593 on the video board. See photo below.*

Photo 1

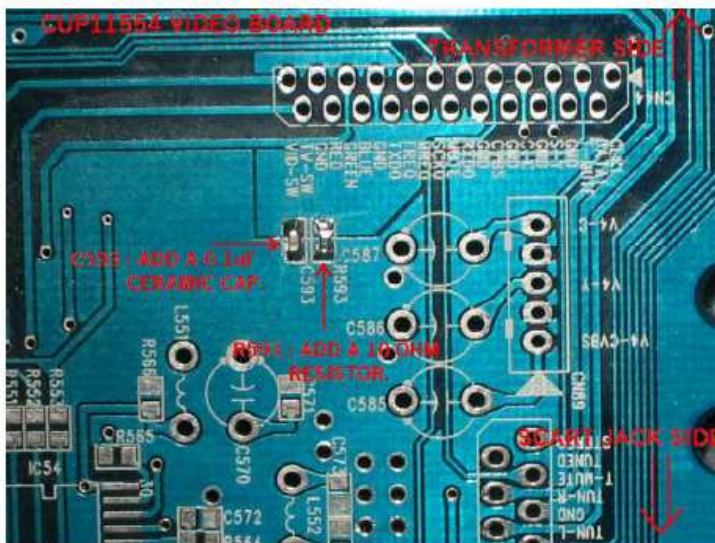

PRODUCTION:

All production to September 2003 is affected.

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357

10/07/03