

Service Information

Circuit Change

PROBLEM: A DC VOLTAGE IS PRESENT ON THE PREAMP OUTPUT WHEN THE

PHONO IS SELECTED

CAUSE: DC OFFSET OUT OF RANGE FOR DC SERVO CIRCUIT

SOLUTION: REPLACE R33 & R34 ON THE RIAA MODULE FROM 19.6 K OHM TO 10.0

K OHM METAL FILM AT 1 % TOLERANCE

PRODUCTION: THIS CHANGE WAS NOT IMPLEMENTED IN PRODUCTION

Contact:

NAD Electronics International 633 Granite Court Pickering, ON Canada L1K 3K1

Voice: 905-831-0799 FAX 905-837-6357

www.nadelectronics.com