

**NAD**

# *Service Information*

---

---

## **Circuit Change**

---

---

**PROBLEM:** A DC VOLTAGE IS PRESENT ON THE PREAMP OUTPUT WHEN THE PHONO IS SELECTED

---

**CAUSE:** DC OFFSET OUT OF RANGE FOR DC SERVO CIRCUIT

---

**SOLUTION:** REPLACE R33 & R34 ON THE RIAA MODULE FROM 19.6 K OHM TO 10.0 K OHM METAL FILM AT 1 % TOLERANCE

---

**PRODUCTION:** THIS CHANGE WAS NOT IMPLEMENTED IN PRODUCTION

---

**Contact:**

**NAD Electronics International  
633 Granite Court  
Pickering, ON Canada L1K 3K1  
Voice: 905-831-0799 FAX 905-837-6357  
[www.nadelectronics.com](http://www.nadelectronics.com)**