



Technical Bulletin T163

Product: A/V Receiver

Hardware Technical Bulletin: T163-H2005-04

Date: February 28/05 **Subject:** Intermittantly shuts down

Note: Implemented in production from serial number:R46T16301386

Previous T.B.'s required:

YES


NO

DESCRIPTION: Unit may shut down, shortly after turn on.

REASON: There is a diode on the standby board that maybe operating intermittantly.

SOLUTION: Locate and identify D756 on the standby board. Change only if the diode is a 1N4148. Change from a 1N4148 to a 1N4004 or equivalent. See figure 1 for details.

Figure 1

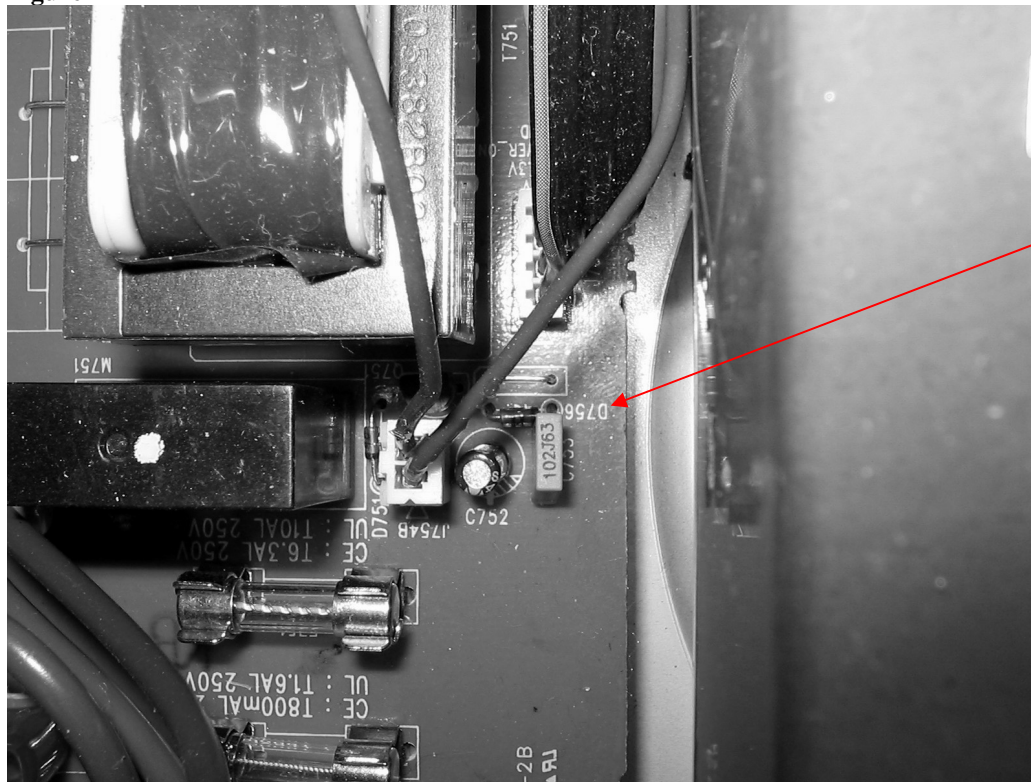

D756
CHANGE
FROM
1N4148 TO
1N4004

Contact:

NAD Electronics International

633 Granite Court

Pickering, ON Canada L1K 3K1

Voice: 905-831-0799 FAX 905-837-6357

www.nadelectronics.com