



Product: DVD Player
Software Technical Bulletin: S2004-01

Date: June 1, 2004 **Subject:** DVD Audio Playabiliy
Note:

Previous T.B.'s required: YES NO

DESCRIPTION: *If you encounter DVD-A Discs that either exhibit Initializing faults or the T533 will not acknowledge an inserted DVD-A Disc.*

REASON: *May not play some DVD-A disc's.*

SOLUTION: *Please ask for T533 Firmware upgrade V 3.92 issued on 05/14/04 .*

The software is loaded as follows:

1. *Connect a monitor/TV then turn on the player*
2. *Open the drawer*
3. *Insert the firmware CD-ROM*
4. *Close the drawer*
5. *The monitor/TV-screen will display as below:
"Firmware Upgrade Mode
Reading 0
Take off the disc and press UP key to upgrade"*
6. *The drawer will open automatically.*
7. *Remove the firmware CD.*

Note: *at this point in time, the process is not complete. The firmware had only been placed in the DVD's buffers.*

The following step is a continuation of the firmware installation:

8. *Press the front panel cursor-UP button to start the firmware installation transfer.
The drawer will close automatically.*

Important Note: DO NOT PRESS ANY BUTTONS ON ANY IR REMOTES OR FRONT PANEL BUTTONS ON THE T533 DURING THIS PROCESS.

9. *Please wait approximately three (3) minutes! There is no visual indication of this process.*
10. *When the firmware installation is complete, the DVD-player will reboot by itself by displaying the splash screen on the monitor/TV.*

Contact:
Bob Moran
Lenbrook America
Ph:1-800-263-4641 ext 4342
Fax:1-800-263-1555

