

T550

The following solutions have been found in the field and may be helpful when servicing the T550.

The software won't load into the T550.

Look at IC07, pin 3 for cold solder, resoldering this pin or other pins may solve this problem.

The T550 won't respond to front panel keyboard or remote commands, intermittently.

Try replacing the crystal on the front panel board, marked X901 4.19 MHz. Also try resoldering the microprocessor on the front panel board IC91.

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
NAD@www.NADelectronics.com