



Technical Bulletin T753

Product: A/V Receiver

Hardware Technical Bulletin: T753-H2005-06

Date: February 28/05 **Subject:** Intermittantly shuts down
Note: Implemented in production from serial number:R44T75307875

Previous T.B.'s required:


- YES
- NO

DESCRIPTION: Unit may shut down, shortly after turn on.

REASON: There is a diode on the standby board that maybe operating intermittantly.

SOLUTION: Locate and identify D756 on the standby board. Change only if the diode is a 1N4148. Change from a 1N4148 to a 1N4001 or equivalent. See figure 1 for details.

Figure 1

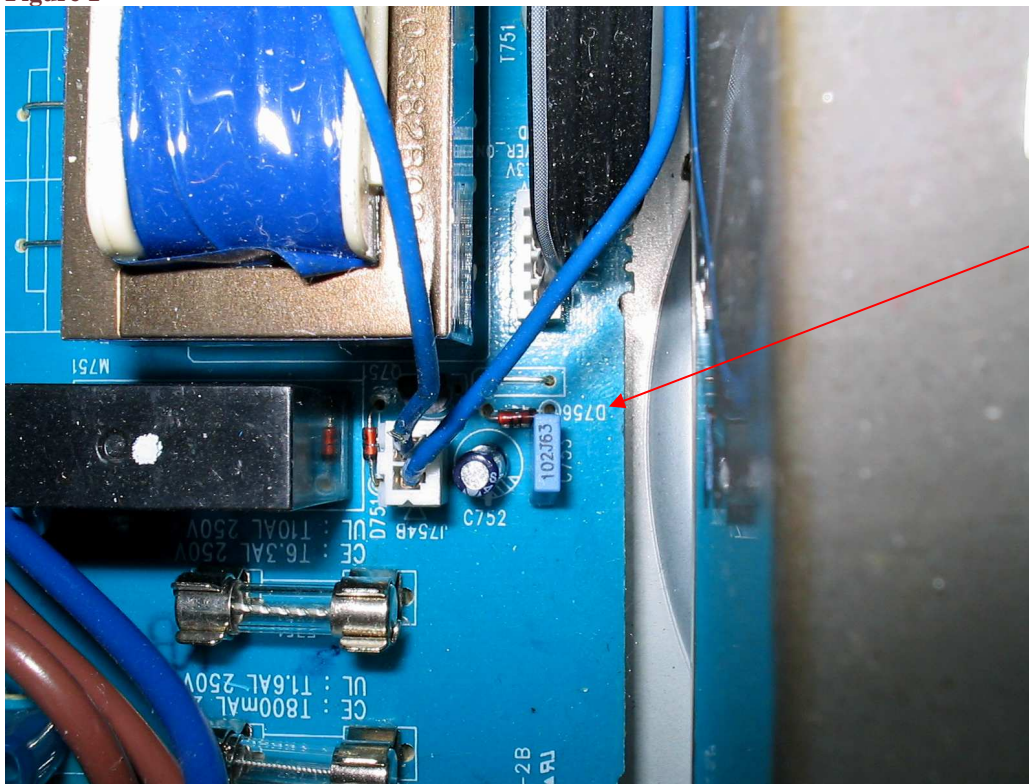

**D756
CHANGE
FROM
1N4148 TO
1N4001**

Contact:
NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
www.nadelectronics.com