
MODIFICATION

PROBLEM:

Sometimes when turning the unit on or off there will be a pop on the subwoofer pre-out


CAUSE:

The muting of the subwoofer preamp comes in too late

SOLUTION:

The following changes, unless otherwise specified, need to be preformed on the multi channel PCB.
Please refer to attached diagram.

1. Remove R665
2. Add a wire between C681 positive pole & D734 cathode side (D734 is located on the main board)
3. Add a 22uF / 10V ce Capacitor over R6111, the negative pole needs to face up.

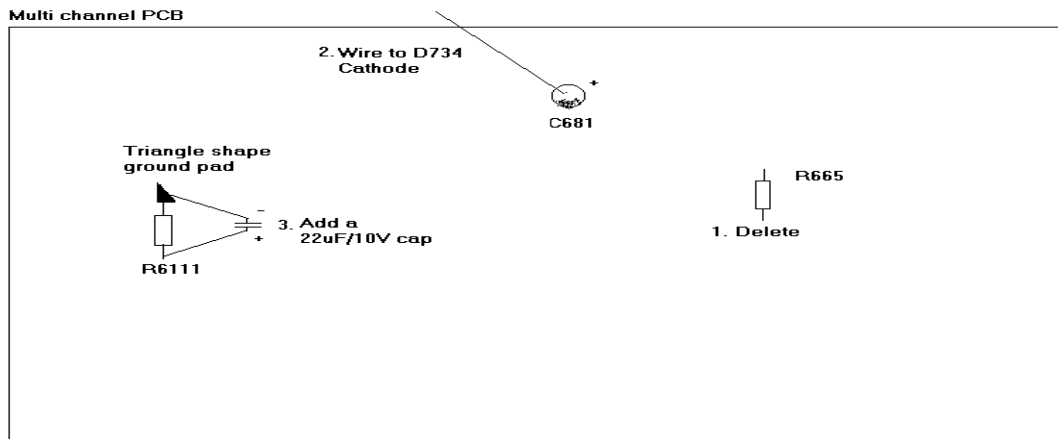

PRODUCTION:

This modification is implemented in production from Serial no. G0YT76100901