

## Modification

---

---

***PROBLEM:** Whistle noise at the -61dB volume setting when Dolby Digital signal from DVD player connected to digital input.*

---

***CAUSE:** Noise coming from U605.*

---

***SOLUTION:** To improve compensation from U605 .  
Remove C662 and C663. Add 200-220 pF ceramic capacitor between pins 2 and 3 of U605. Add 200-220pF capacitor between pins 5 and 6 of U605.*

---

### ***PRODUCTION:***

This modification has been implemented in production from serial number: G13T76102701.

---

### **Contact:**

**NAD Electronics International  
633 Granite Court  
Pickering, ON Canada L1K 3K1  
Voice: 905-831-0799 FAX 905-837-6357  
NAD@www.NADelectronics.com**