

NAD

Service Information T761

Circuit Change

PROBLEM: *Distortion ,hum and or crackling noises from all speakers in any surround mode. Stereo mode not affected.*

CAUSE: *Capacitor C107 2200uF 16V not filtering the ripple to the 5v regulators on the DSP board due to prolonged heating of C107.*

SOLUTION: *Replace C107 rated 85 degrees celcius should be changed to 2200 uf 16v 105 degrees celcius rating.*

Note: *The units affected for the T761 are serial numbers starting with #GOYT761 and GOZT761. Later production have the higher rated capacitor implemented.*

T751 and some T760 units may be affected.

It is advisable to change the 85 degree capacitor on T751, T761, and T760 units being serviced for any reason.

Contact:

NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
NAD@www.NADelectronics.com