

Technical Bulletin T773

Product: A/V Receiver

Hardware Technical Bulletin: T773-H2005-05

Date: February 28/05 Subject: Intermittantly shuts down

Note: Implemented in production from serial number:R44T77301971

Previous T.B.'s required:


□ YES

■ NO

DESCRIPTION: Unit may shut down, shortly after turn on.

REASON: There is a diode on the standby board that maybe operating intermittantly.

SOLUTION: Locate and identify D756 on the standby board. Change only if the diode is a 1N4148. Change from a 1N4148 to a 1N4004 or equivalent. See figure 1 for details.

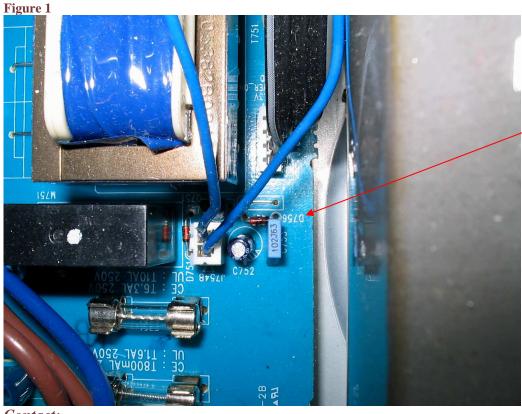

D756 CHANGE FROM 1N4148 TO 1N4004

Contact:

NAD Electronics International 633 Granite Court Pickering, ON Canada L1K 3K1

Voice: 905-831-0799 FAX 905-837-6357

www.nadelectronics.com