

<b>ONKYO.</b>		<b>SERVICE BULLETIN NO:03007</b>	
MANAGER Kiyoshi Matsuoka	GL Seiji Ichikami	DESIGN Terukazu Matumi	
2003/07/25	2003/07/25	2003/07/25	
MODELS : DTA-9.4			
SUBJECT : Improvement of the sensitivity of DC detection circuit			

Symptom:

When an excessive signal is inputted into amplifier, DC detection circuit operates and results No sound.

Cause:

The DC current detection circuit is too sensitive.

Procedure for service:

In NAAF-7797 R593, chip resistor is changed from 10K to 3.3K

DAT-9.4 has seven units of NAAF-7797 and do this change for all units.

Circuit No.	Before change		After change	Description	Remarks
	Part No.	Description	Part No.		
R593	435031034R1	RN72K1J-103J	435033324R1	RN72K1J-332J	

Refer to the attached file---Page 2

Application: ...All seven power amplifier modules per unit.

Marking: Mark "A" after the serial number.

Revised: By Gedion Teklewolde

History:

SERVICE BULLETIN  
NO:03007

**U15** POWER AMPLIFIER PC BOARD  
(NAAF-7797)  
Component side

