



Service Bulletin 04004
6/21/04

MODELS : DTR-6.4,DTR-5.4

SUBJECT : The contents of memory return to the initial value or the control keys cannot operate.

Symptom: The contents of memory return to the initial setting or the control keys cannot operate.(In this case, please pull out and re-supply a power cord at once (reset microprocessor), and confirm whether the contents of a memory have disappeared.)

Cause: Noise may join on the line of a clock and data from main microprocessor to a sub microprocessor, and a product may become the symptom above.

Procedure for service: Replace the filters of R7095 and R7096 on the DSP printed Circuit Board NADG-7952. **Replace with new part number 230955R2.**

CIRCUIT NO.	PART NAME	SPEC. AFTER CHANGE	NEW PART NO. AFTER CHANGE	SPEC. BEFORE CHANGE	ORIGINAL PART NO. BEFORE CHANGE
R7095,R7096	EMI FILTER	BK1608HS102-T	230955R2	BK1608LM182-T	230958R1