

CONFIDENTIAL



18 Park Way, Upper Saddle River, NJ 07458

## Service Bulletin

No. 006R1

Date: September 2, 2005

---

**Model:** TA-RW255

**Subject:** No Sound output from Deck "B" after switching from Deck "A".

**Symptom:** No Sound output from Deck "B" after switching from Deck "A". The symptom is the result of a programming error in the original Microprocessor.

**Solution:** Replace the Microprocessor with the improved version. After the Microprocessor has been replaced add the letter "A" to the end of the units Serial Number. Note: If version 1.00 is installed into a set that originally had version 1.01 the following error will occur: After Deck A is switched to Deck B in Continuous tape playback mode, sound will not be produced from Deck B.

### Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
Q701	MPD78042FGF-140-3B9	22242245R3	MPD78042FGF-141-3B9	22242284R3

---

#### CONFIDENTIALITY NOTICE:

This document and the information it contains is intended for the exclusive use of Authorized ONKYO Service Centers and their employees. This document may contain information that is privileged, confidential and exempt from disclosure under applicable law and terms of the ONKYO Service Agreement. Any dissemination, distribution or copying of this document and the information it contains is strictly prohibited.