

CONFIDENTIAL

ONKYO

18 Park Way, Upper Saddle River, NJ 07458

Technical Tip


Date: May 25, 2006

Model: Sample TX-SR503, HT-R530

Subject: Relay constantly clicks, won't power ON

Symptom: The relays click but the set will not power ON.

Solution: Check Fuse resistor R9593 for an open condition and replace if necessary. Resolder the terminal lugs on the Main transformers secondary.

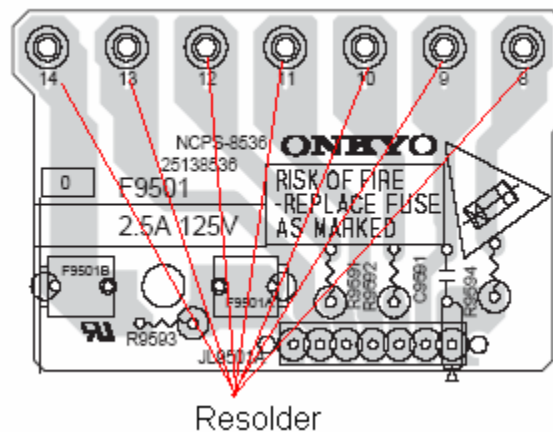

CONFIDENTIALITY NOTICE:

This document and the information it contains is intended for the exclusive use of Authorized ONKYO Service Centers and their employees. This document may contain information that is privileged, confidential and exempt from disclosure under applicable law and terms of the ONKYO Service Agreement. Any dissemination, distribution or copying of this document and the information it contains is strictly prohibited.


CONFIDENTIALITY NOTICE:

The content of this Bulletin is Confidential Information as defined in the applicable Independent Service Center Agreement. It is for the exclusive use of Onkyo Authorized Service Centers. Republication, dissemination or posting of this Bulletin on the internet or in any blog is strictly prohibited.

ONKYO

SERVICE TIPS
NO: May 25, 2006
MODELS : HT-R330
SUBJECT : Relay constantly clicks, won't power ON only sound TiTaTiTa..

Solution: Check do you have +12 V to Reg IC Q5640 , R9593 may open or have bad solder on connection. On T901. lost AC on SEC2-1 or SEC2-2
Check Low voltage supply circuit.

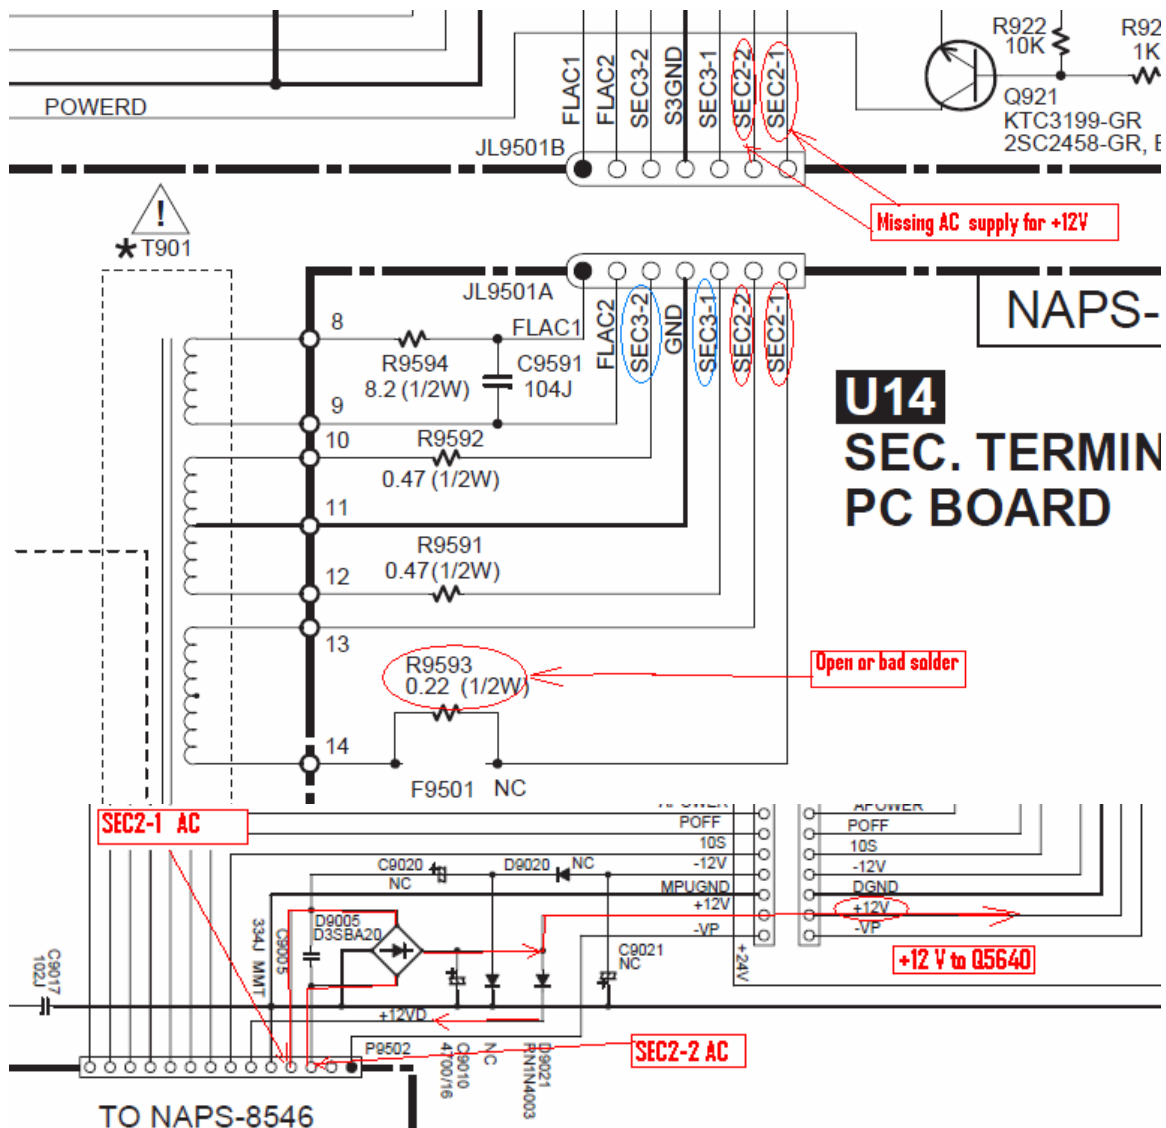**CONFIDENTIALITY NOTICE:**

The content of this Bulletin is Confidential Information as defined in the applicable Independent Service Center Agreement. It is for the exclusive use of Onkyo Authorized Service Centers. Republication, dissemination or posting of this Bulletin on the internet or in any blog is strictly prohibited.