

Model: STR-D565, STR-D665

No. 494

Subject: Noise in Rear Channel

Date: October 10, 1996

Symptom:

(154) The customer may complain of noise or distorted sound from the rear channel when the volume level is increased.

Solution: Add the following resistor as outlined below

| REF | DESCRIPTION | PART NUMBER |
|-----|--------------------------|--------------|
| N/A | 100K OHM CARBON RESISTOR | 1-249-971-11 |

MAIN BOARD
— CONDUCTOR SIDE —

