



Service Bulletin

No. : MZ05-032


Date: January 5, 2007

Model: SA8400, SA-11S1, SA-15S1, DV9500

Subject: Improvement of Disc vibration

Symptom: During playback, an eccentric or off center Disc will cause the unit to vibrate.

Solution: Replace the 4 traverse Mechanism Dampers to the new hard type.

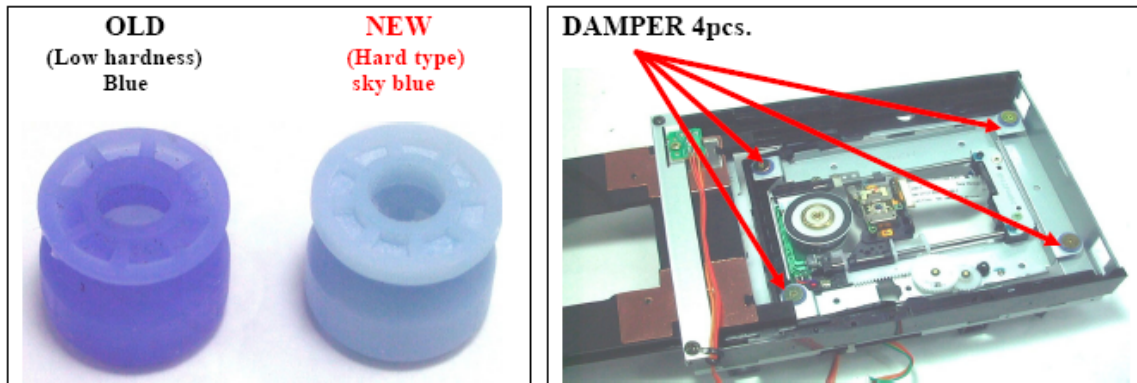

Parts:

| Ref # | FORMER | | NEW | |
|-------|----------------|---------------|-------------------|---------------|
| | Description | Part Number | Description | Part Number |
| 49 | DAMPER-SI25-LB | 90M13AK130210 | DAMPER-LIGHT-BLUE | 90M13AK130220 |

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.