



Service Bulletin

No.: MZ10-002 **Date:** April 22, 2010

Model: UD9004


Subject: Correction of power supply circuit. (For SACD Block power supply

+3.3V)

Countermeasure is applicable only upon claim from the customer.

Symptom: When a SACD disc is played, "LOADING" or "NO PLAY" might be displayed.

Solution: COUNTERMEASURE: Remove C940 (Electric capacitor) located on 8U-310010 (FE/SACD UNIT). Please confirm playback of the SACD disc after removing the C940.

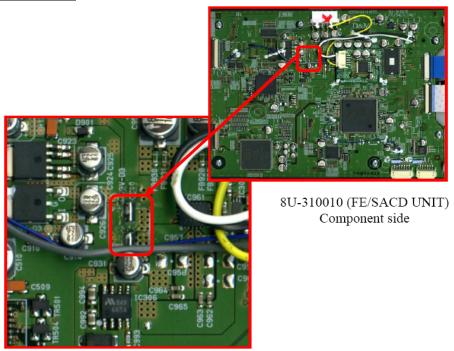

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Serial Number Range: Please apply the above modification to the models in the following serial numbers. (Full-Digits) ********000001 ~ ********000170

CONFIDENTIALITY NOTICE: