


Numark[®]


Service Information

CDX


www.numark.com

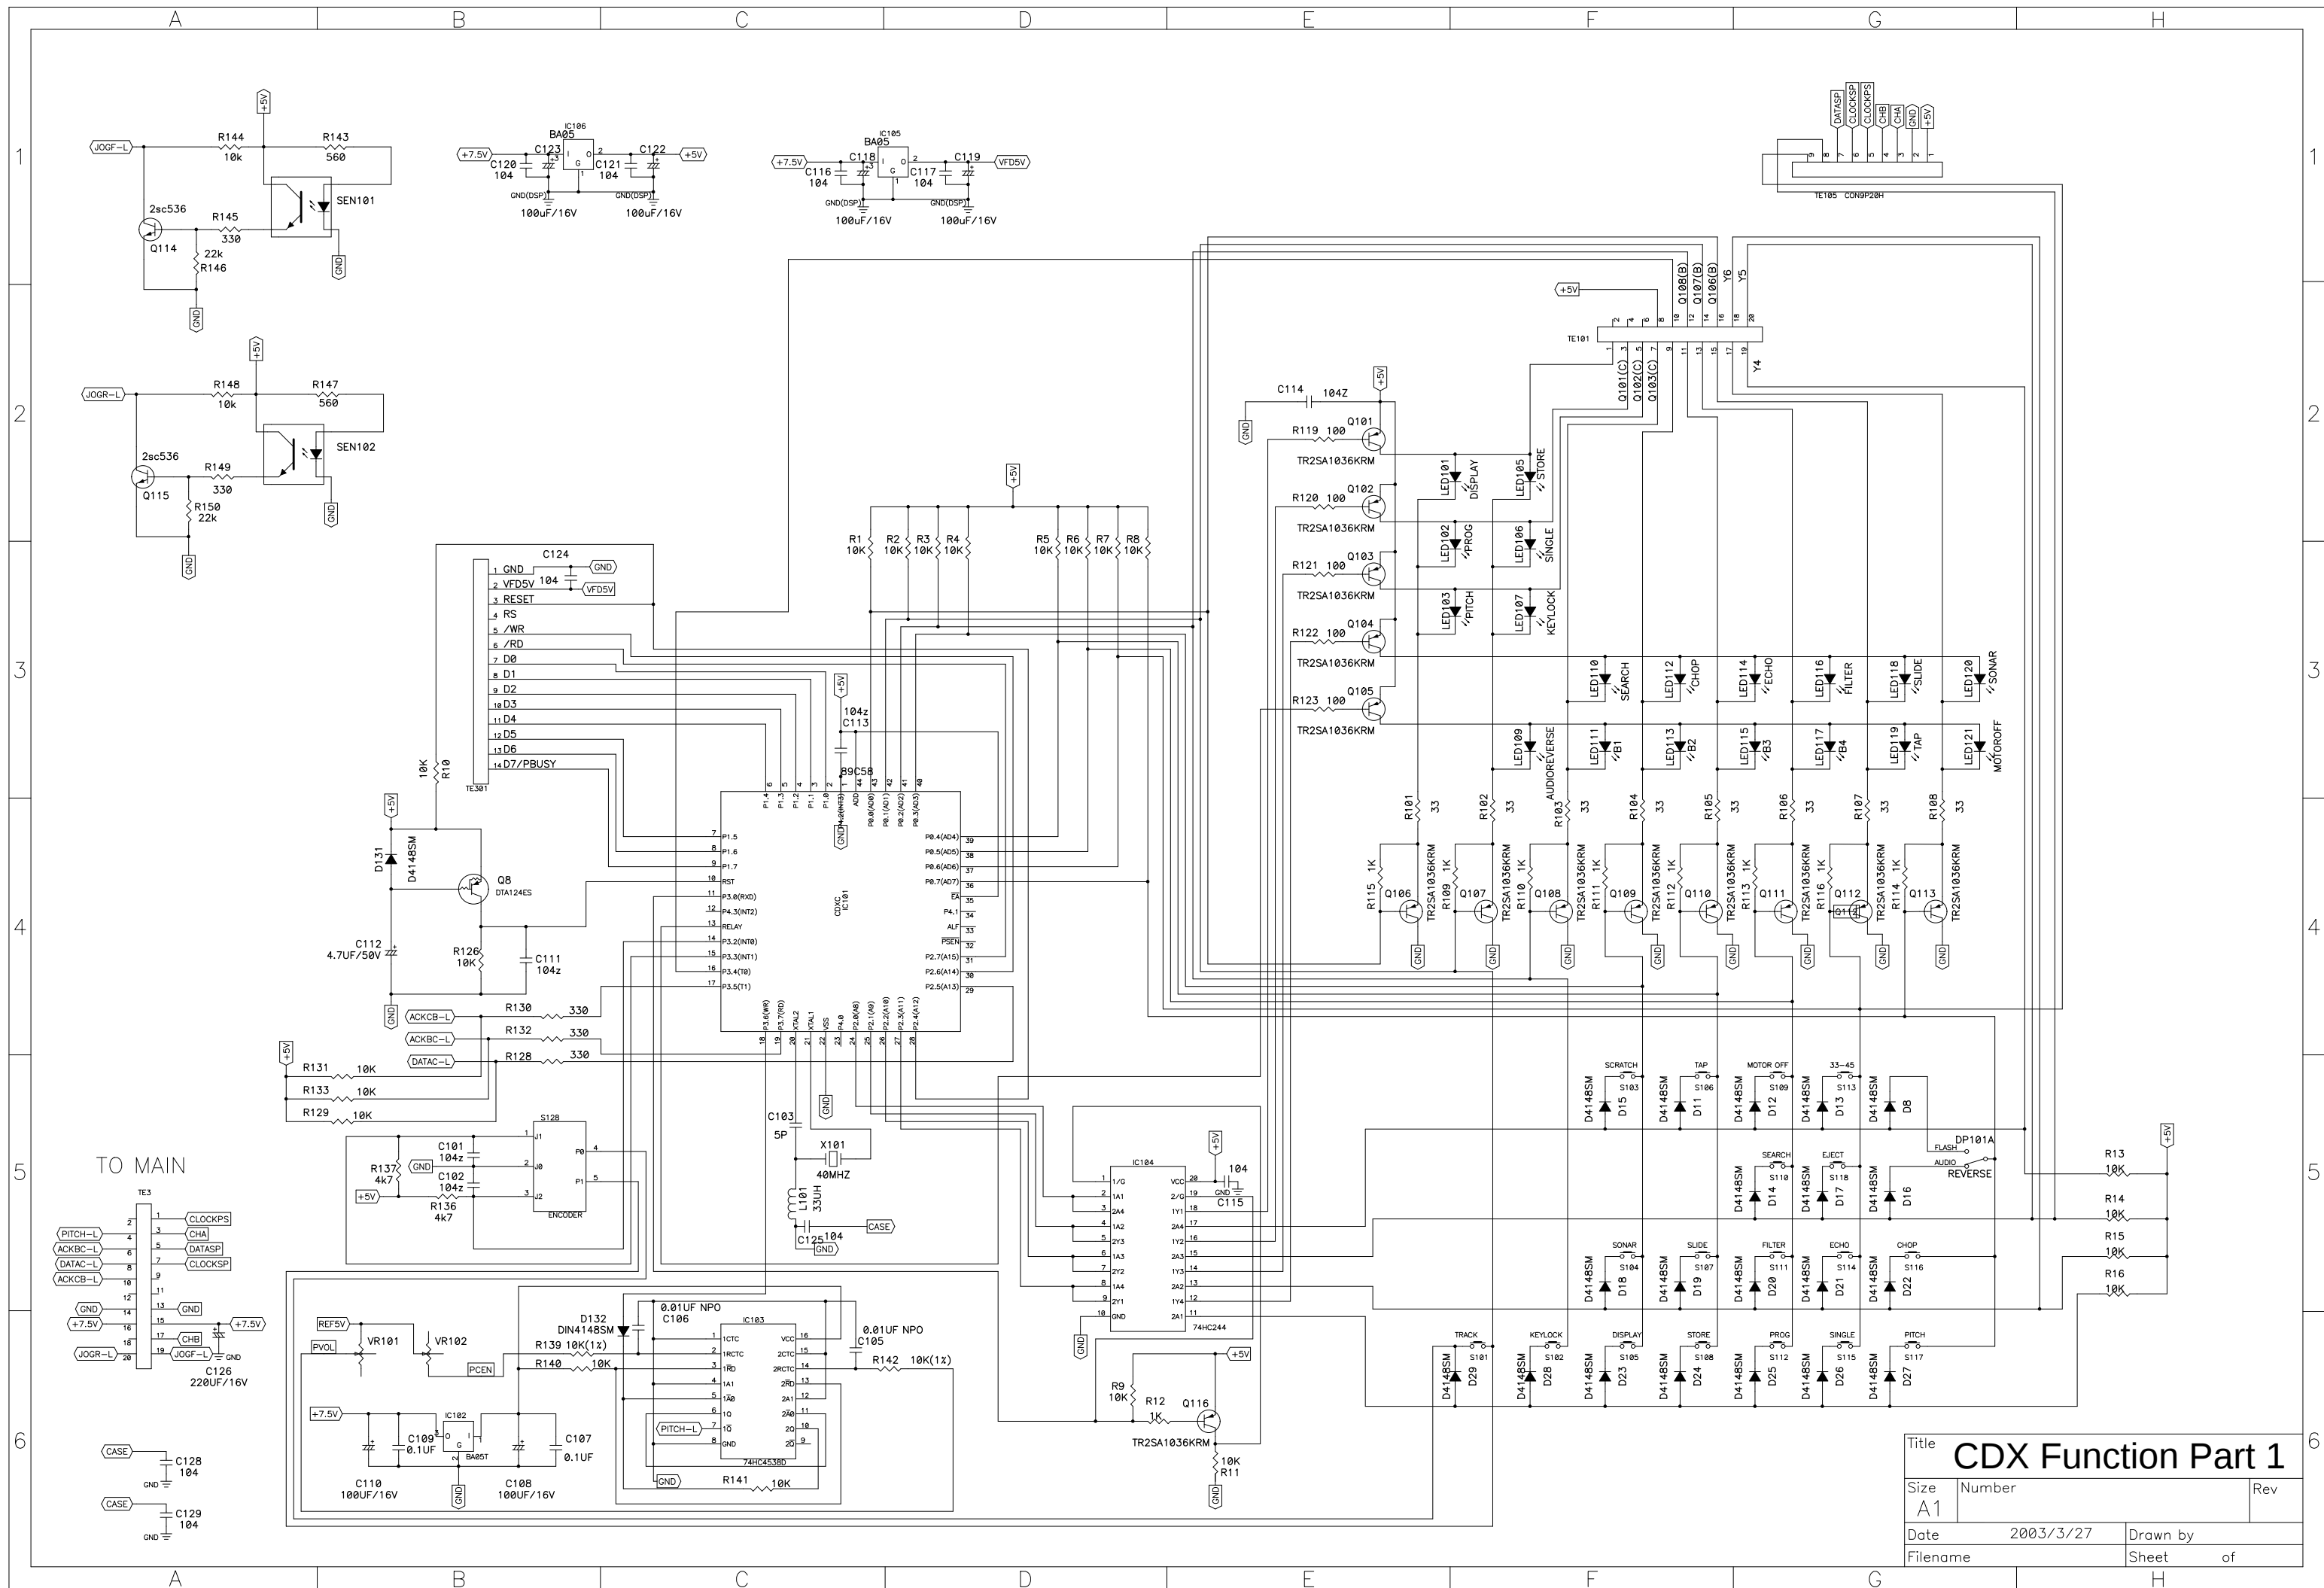

Title			CDX Function Part 1	
Size	Number	Rev		
A1				
Date	2003/3/27	Drawn by		
Filename		Sheet	of	

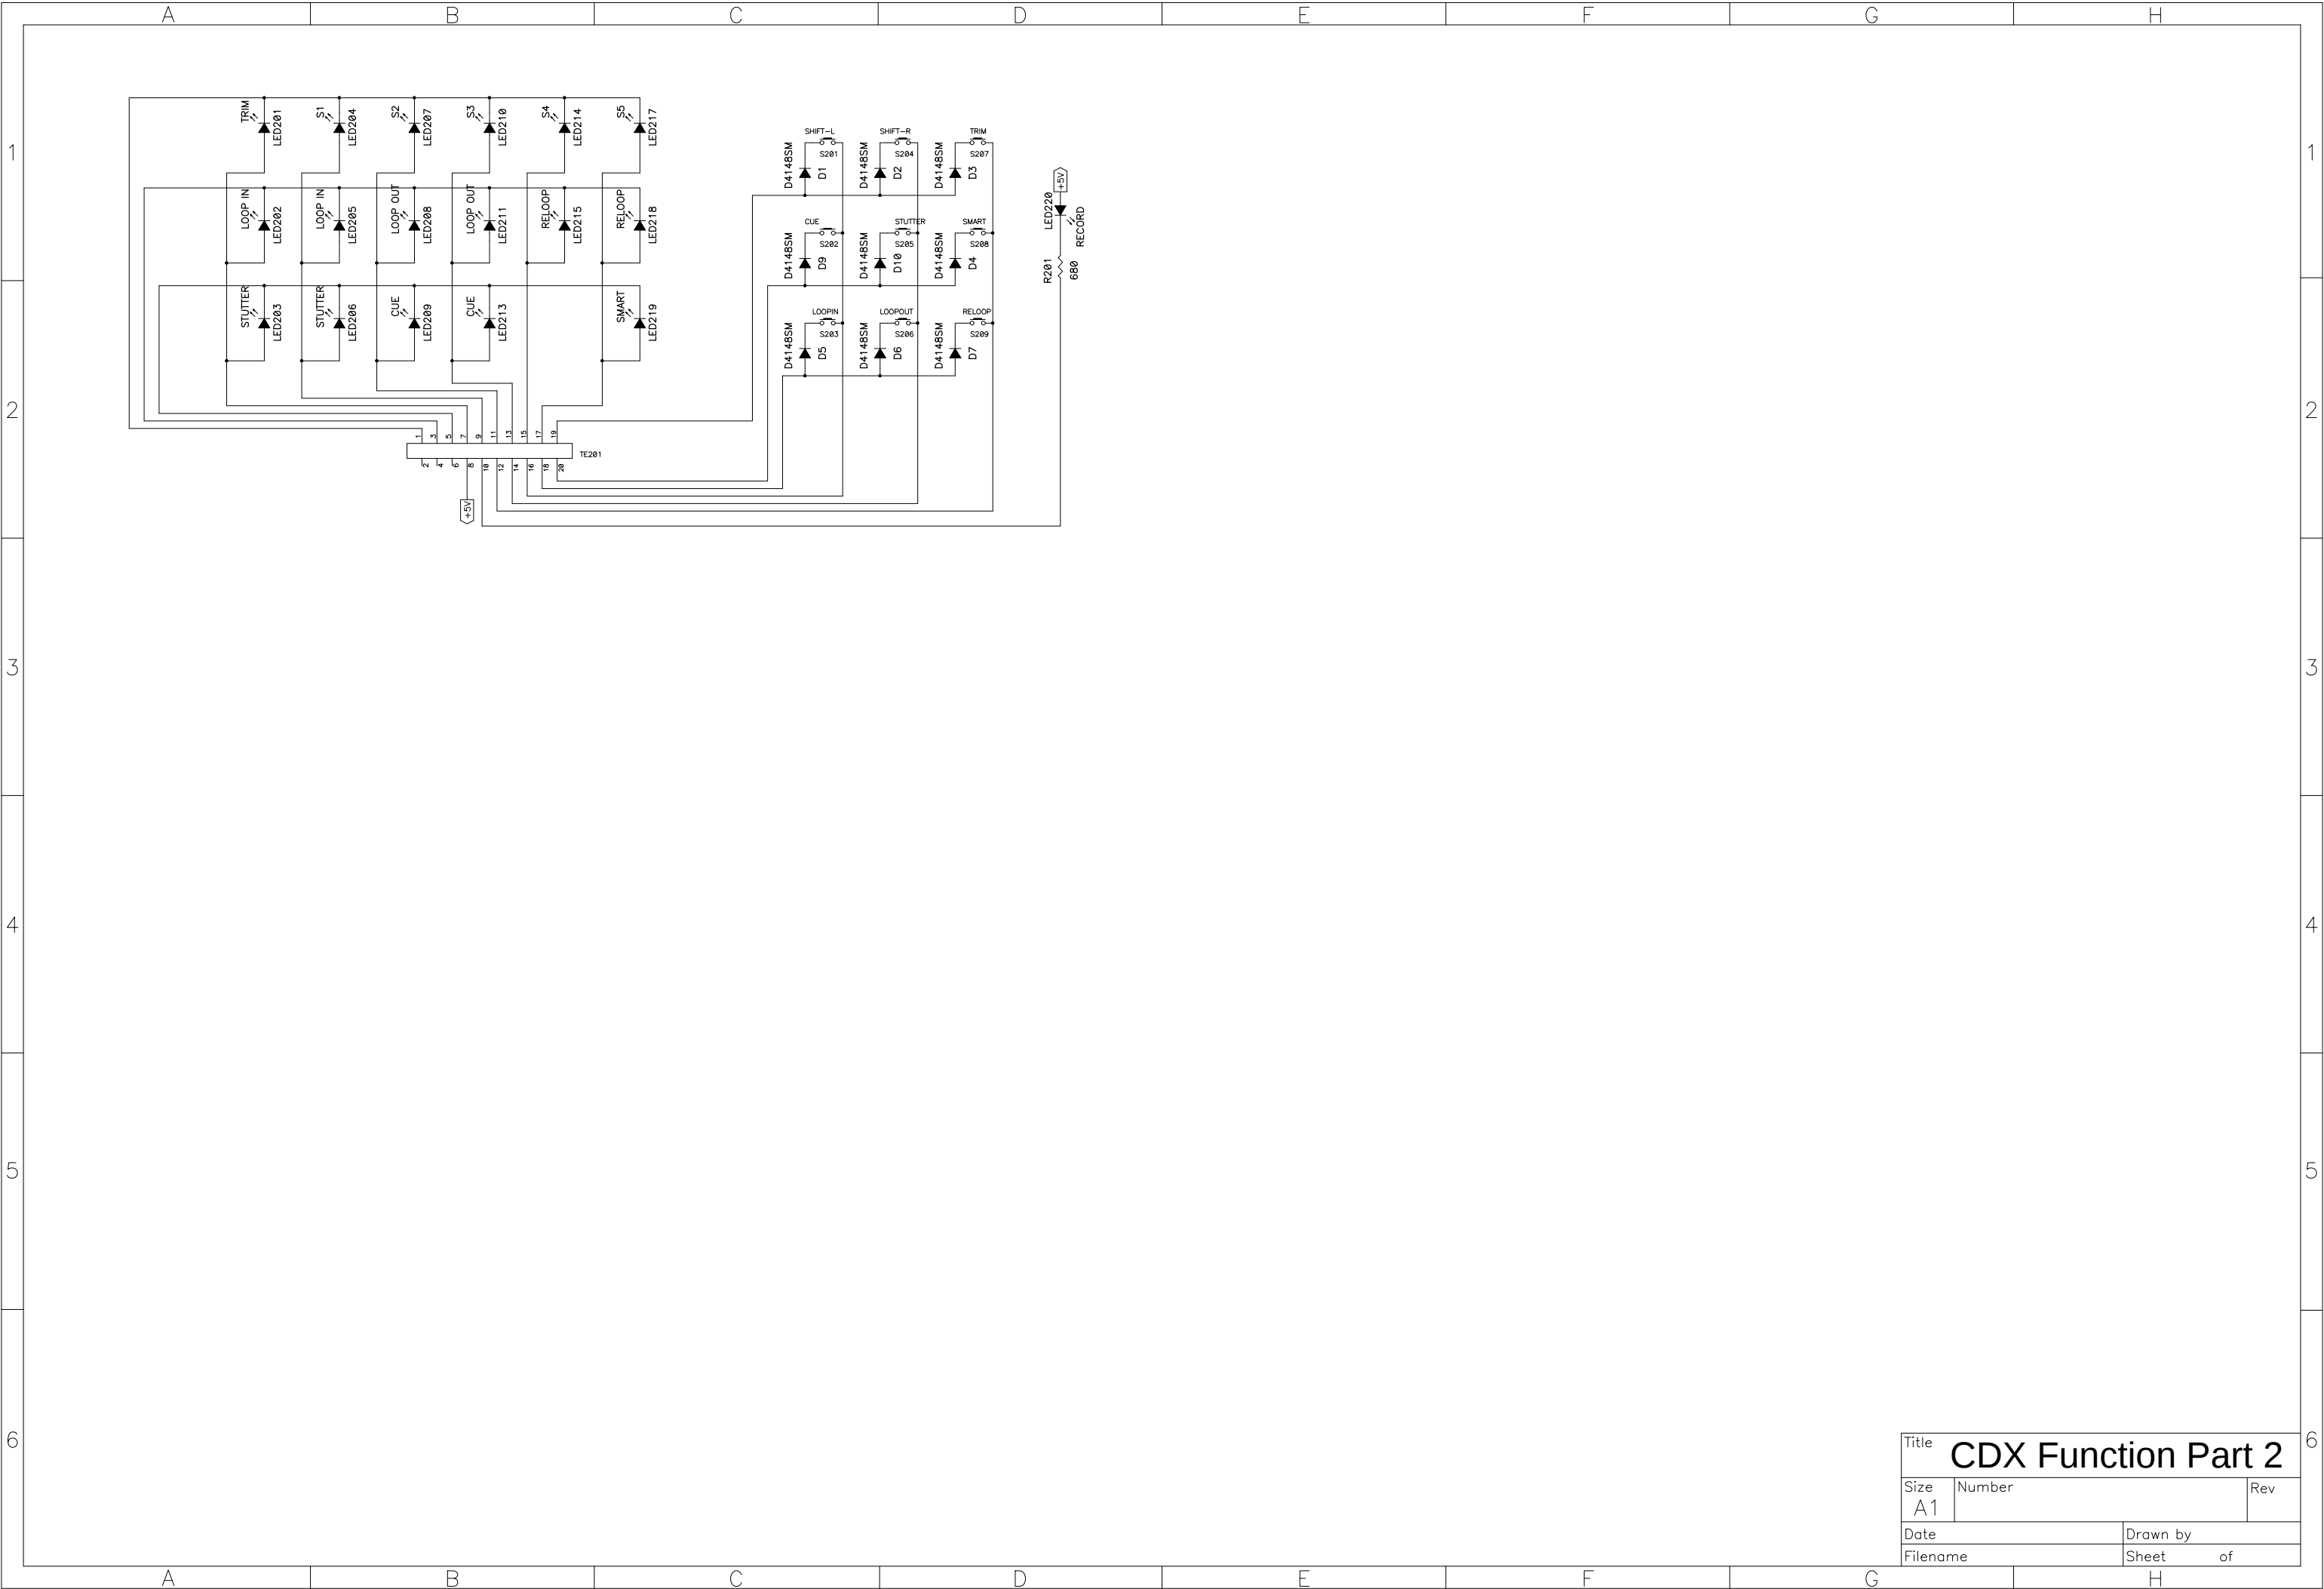


Title			CDX Function Part 2		
Size	Number				Rev
A1					
Date			Drawn by		
Filename			Sheet of		

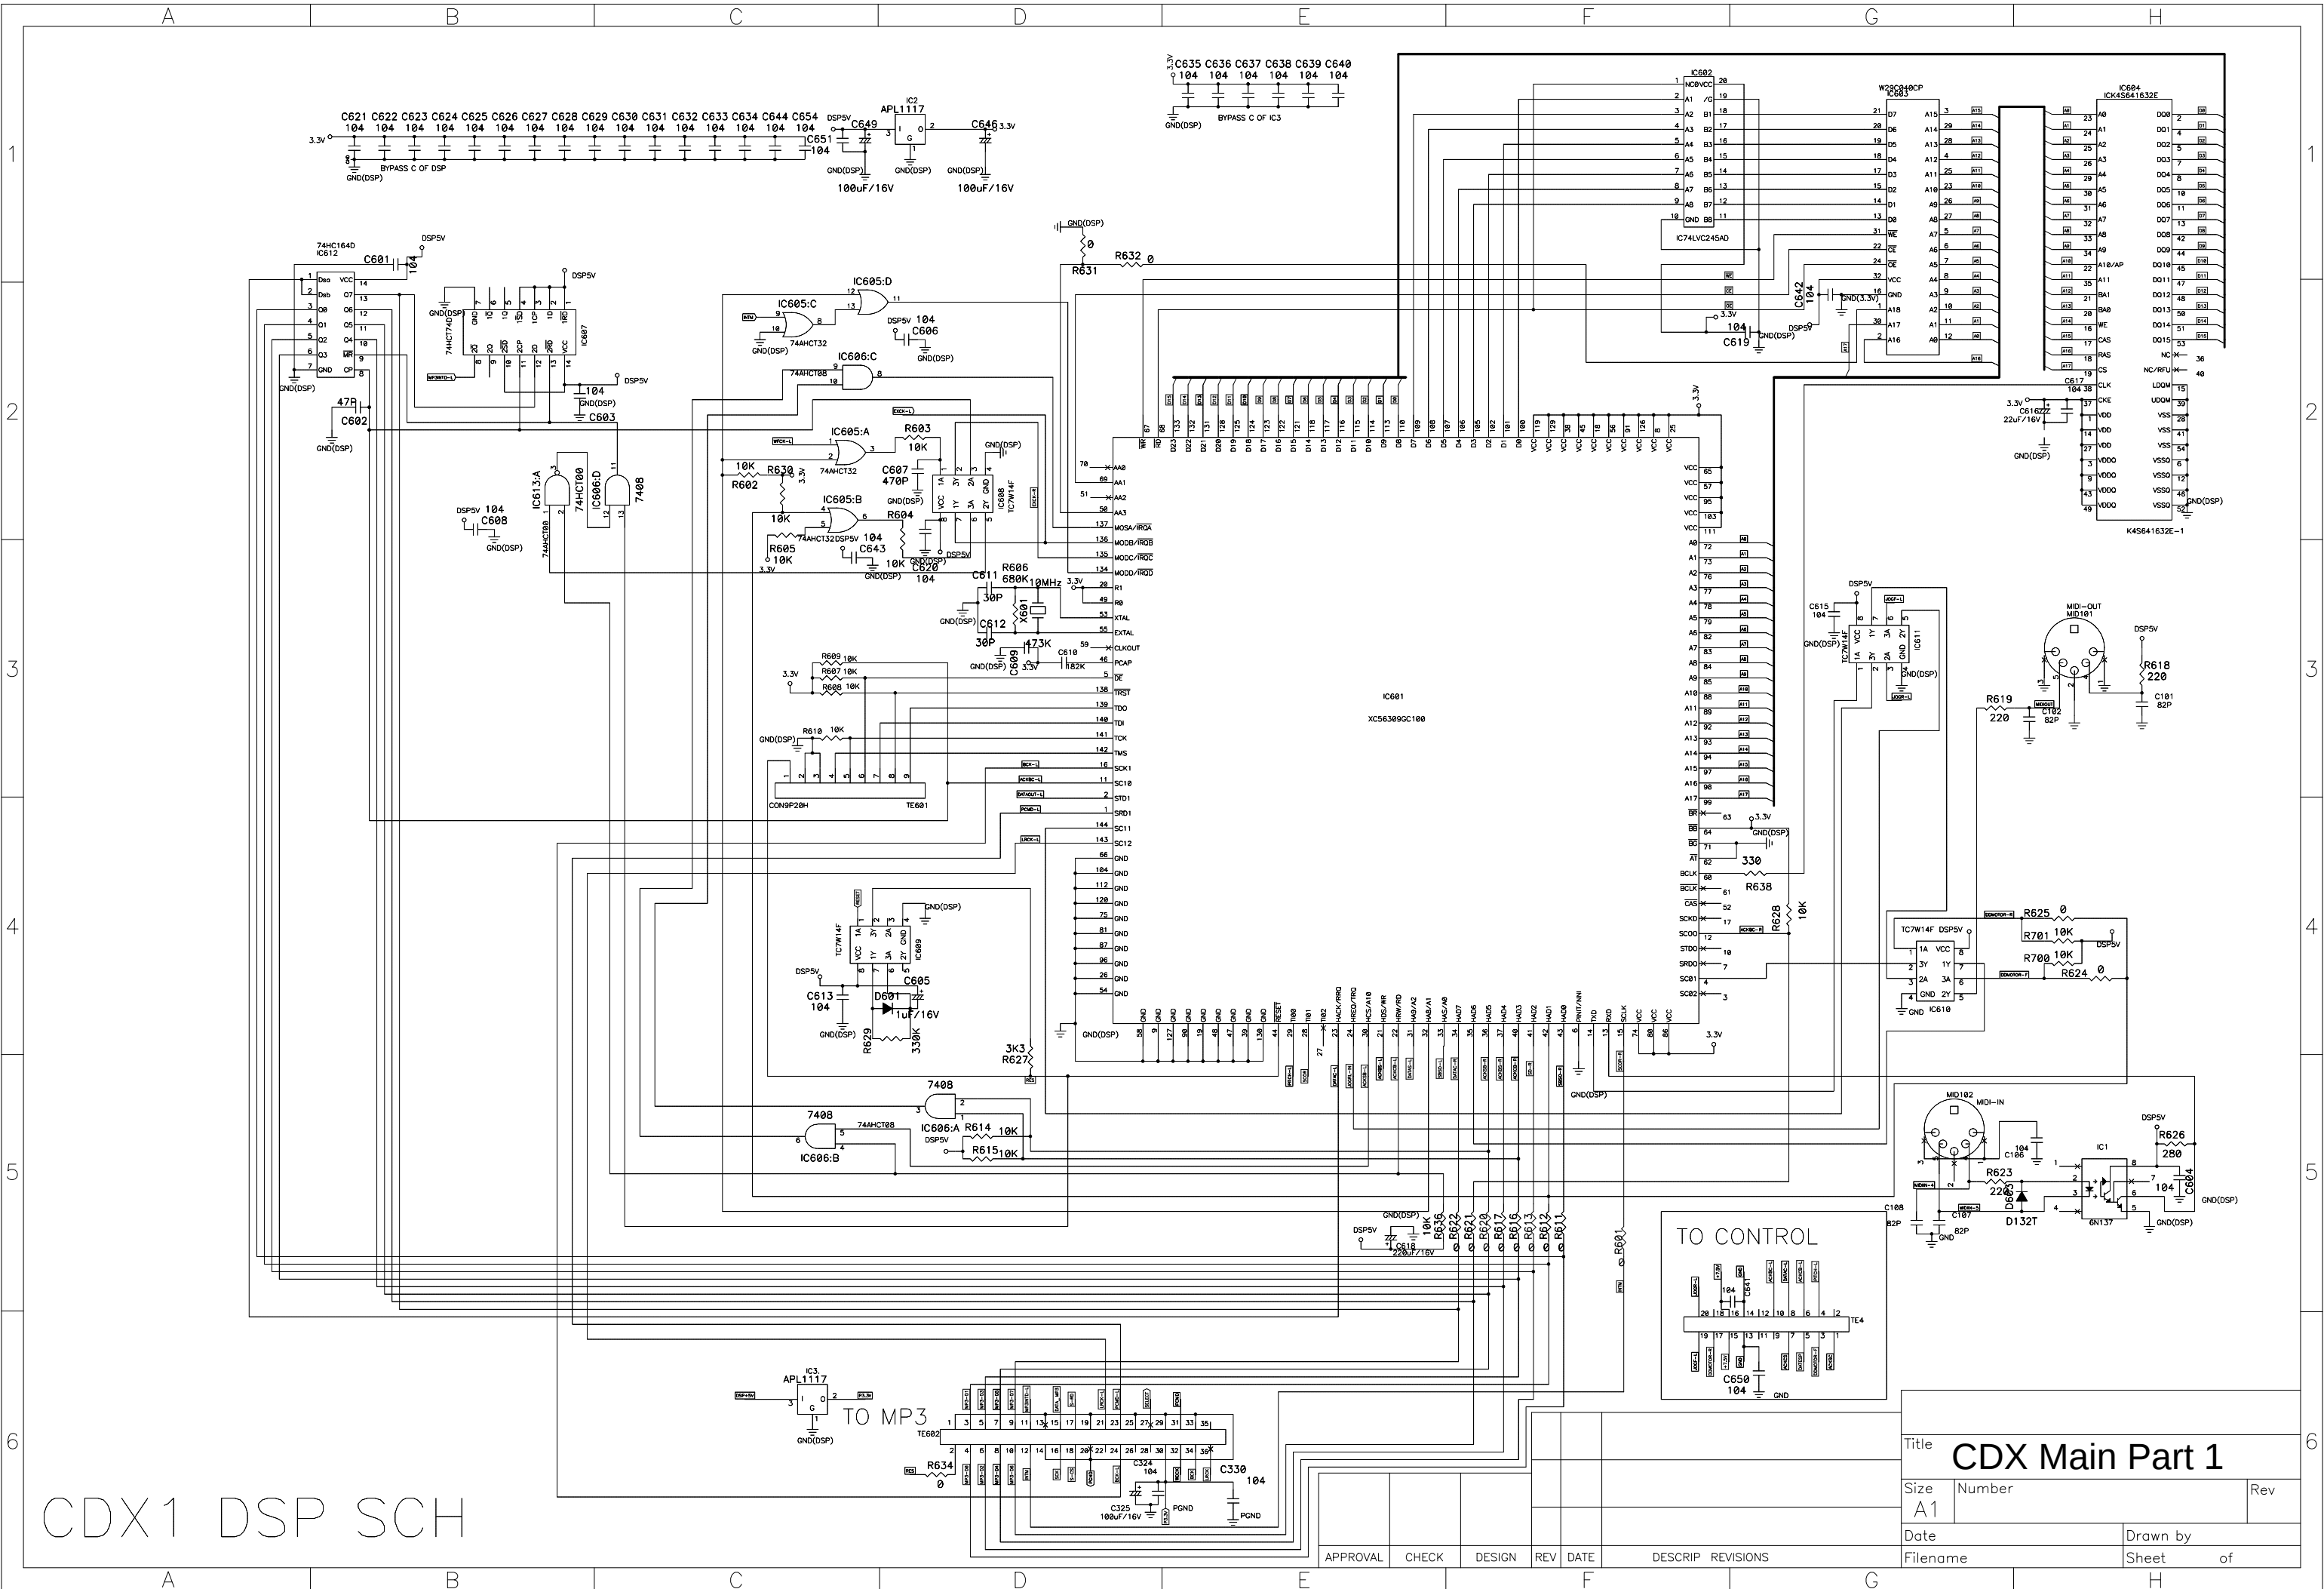


CDX1 DSP SCH


Title		CDX Main Part 1	
Size	A1	Number	Rev
Date	Drawn by		
Filename	Sheet	of	


CDX1 MICON SCH



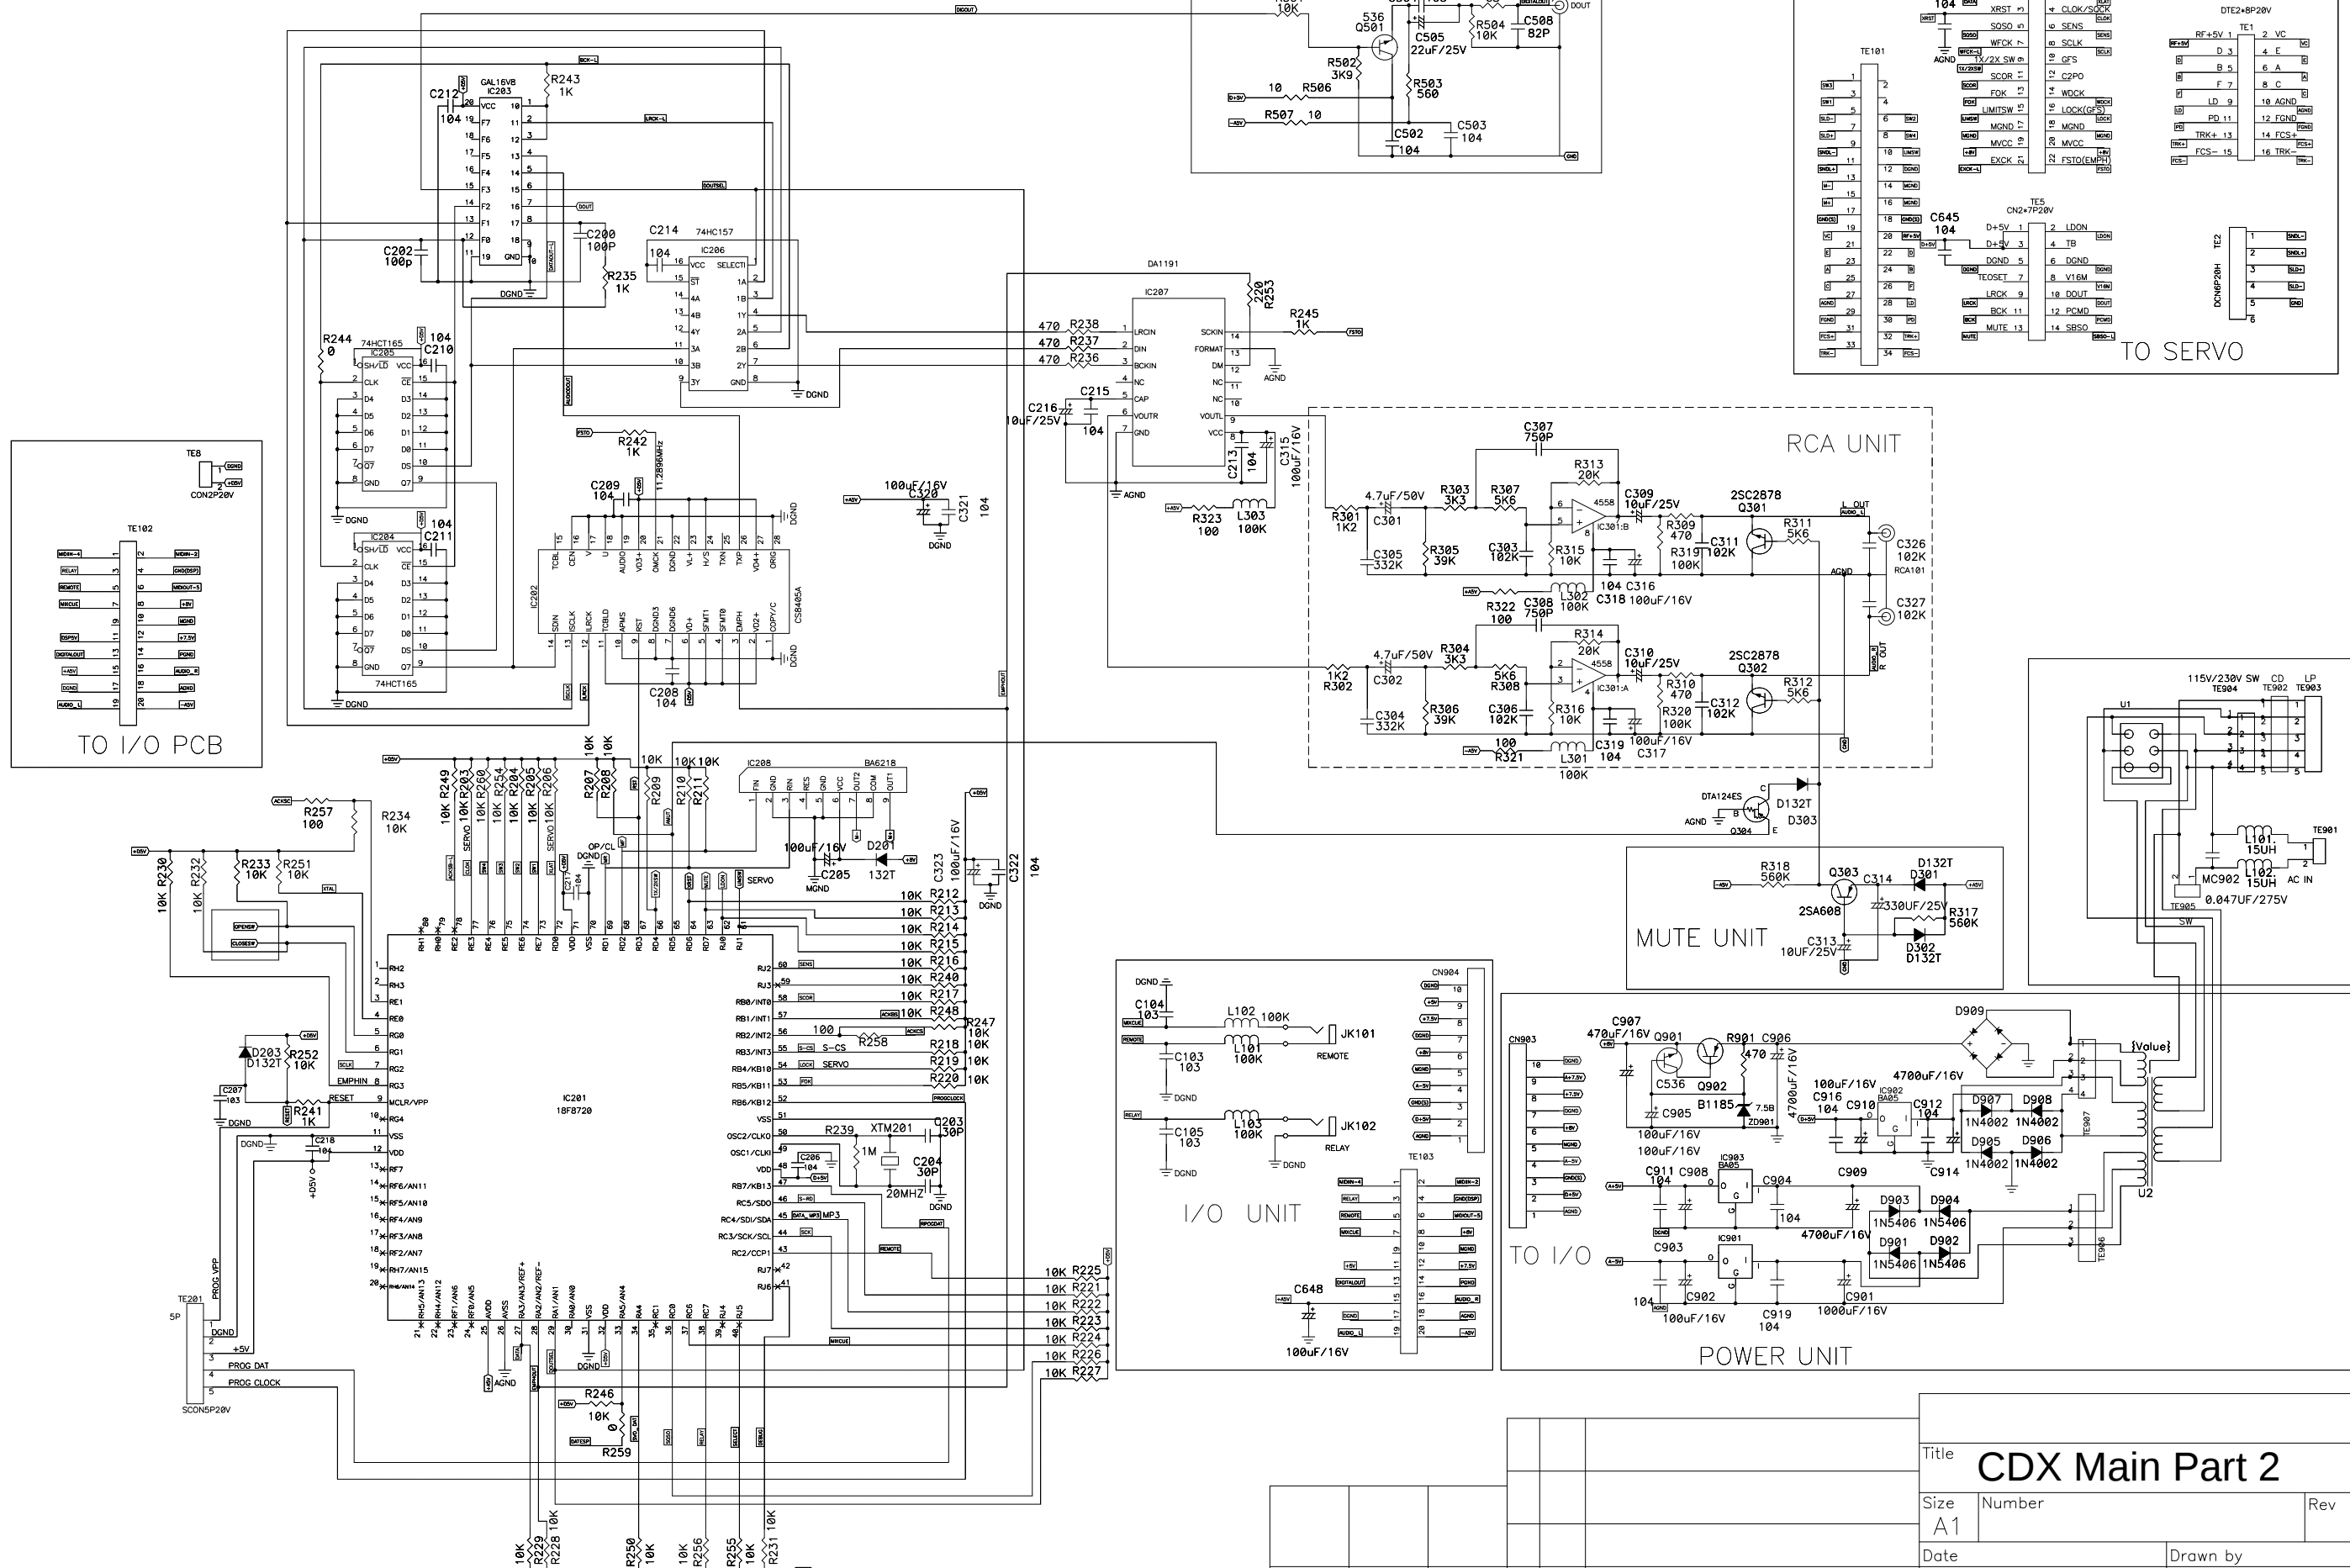


						Title			CDX Main Part 2			
						Size	Number				Rev	
						A1						
						Date			Drawn by			
APPROVAL		CHECK		DESIGN		REV	DATE	DESCRIP			REVISIONS	
						Filename			Sheet of			

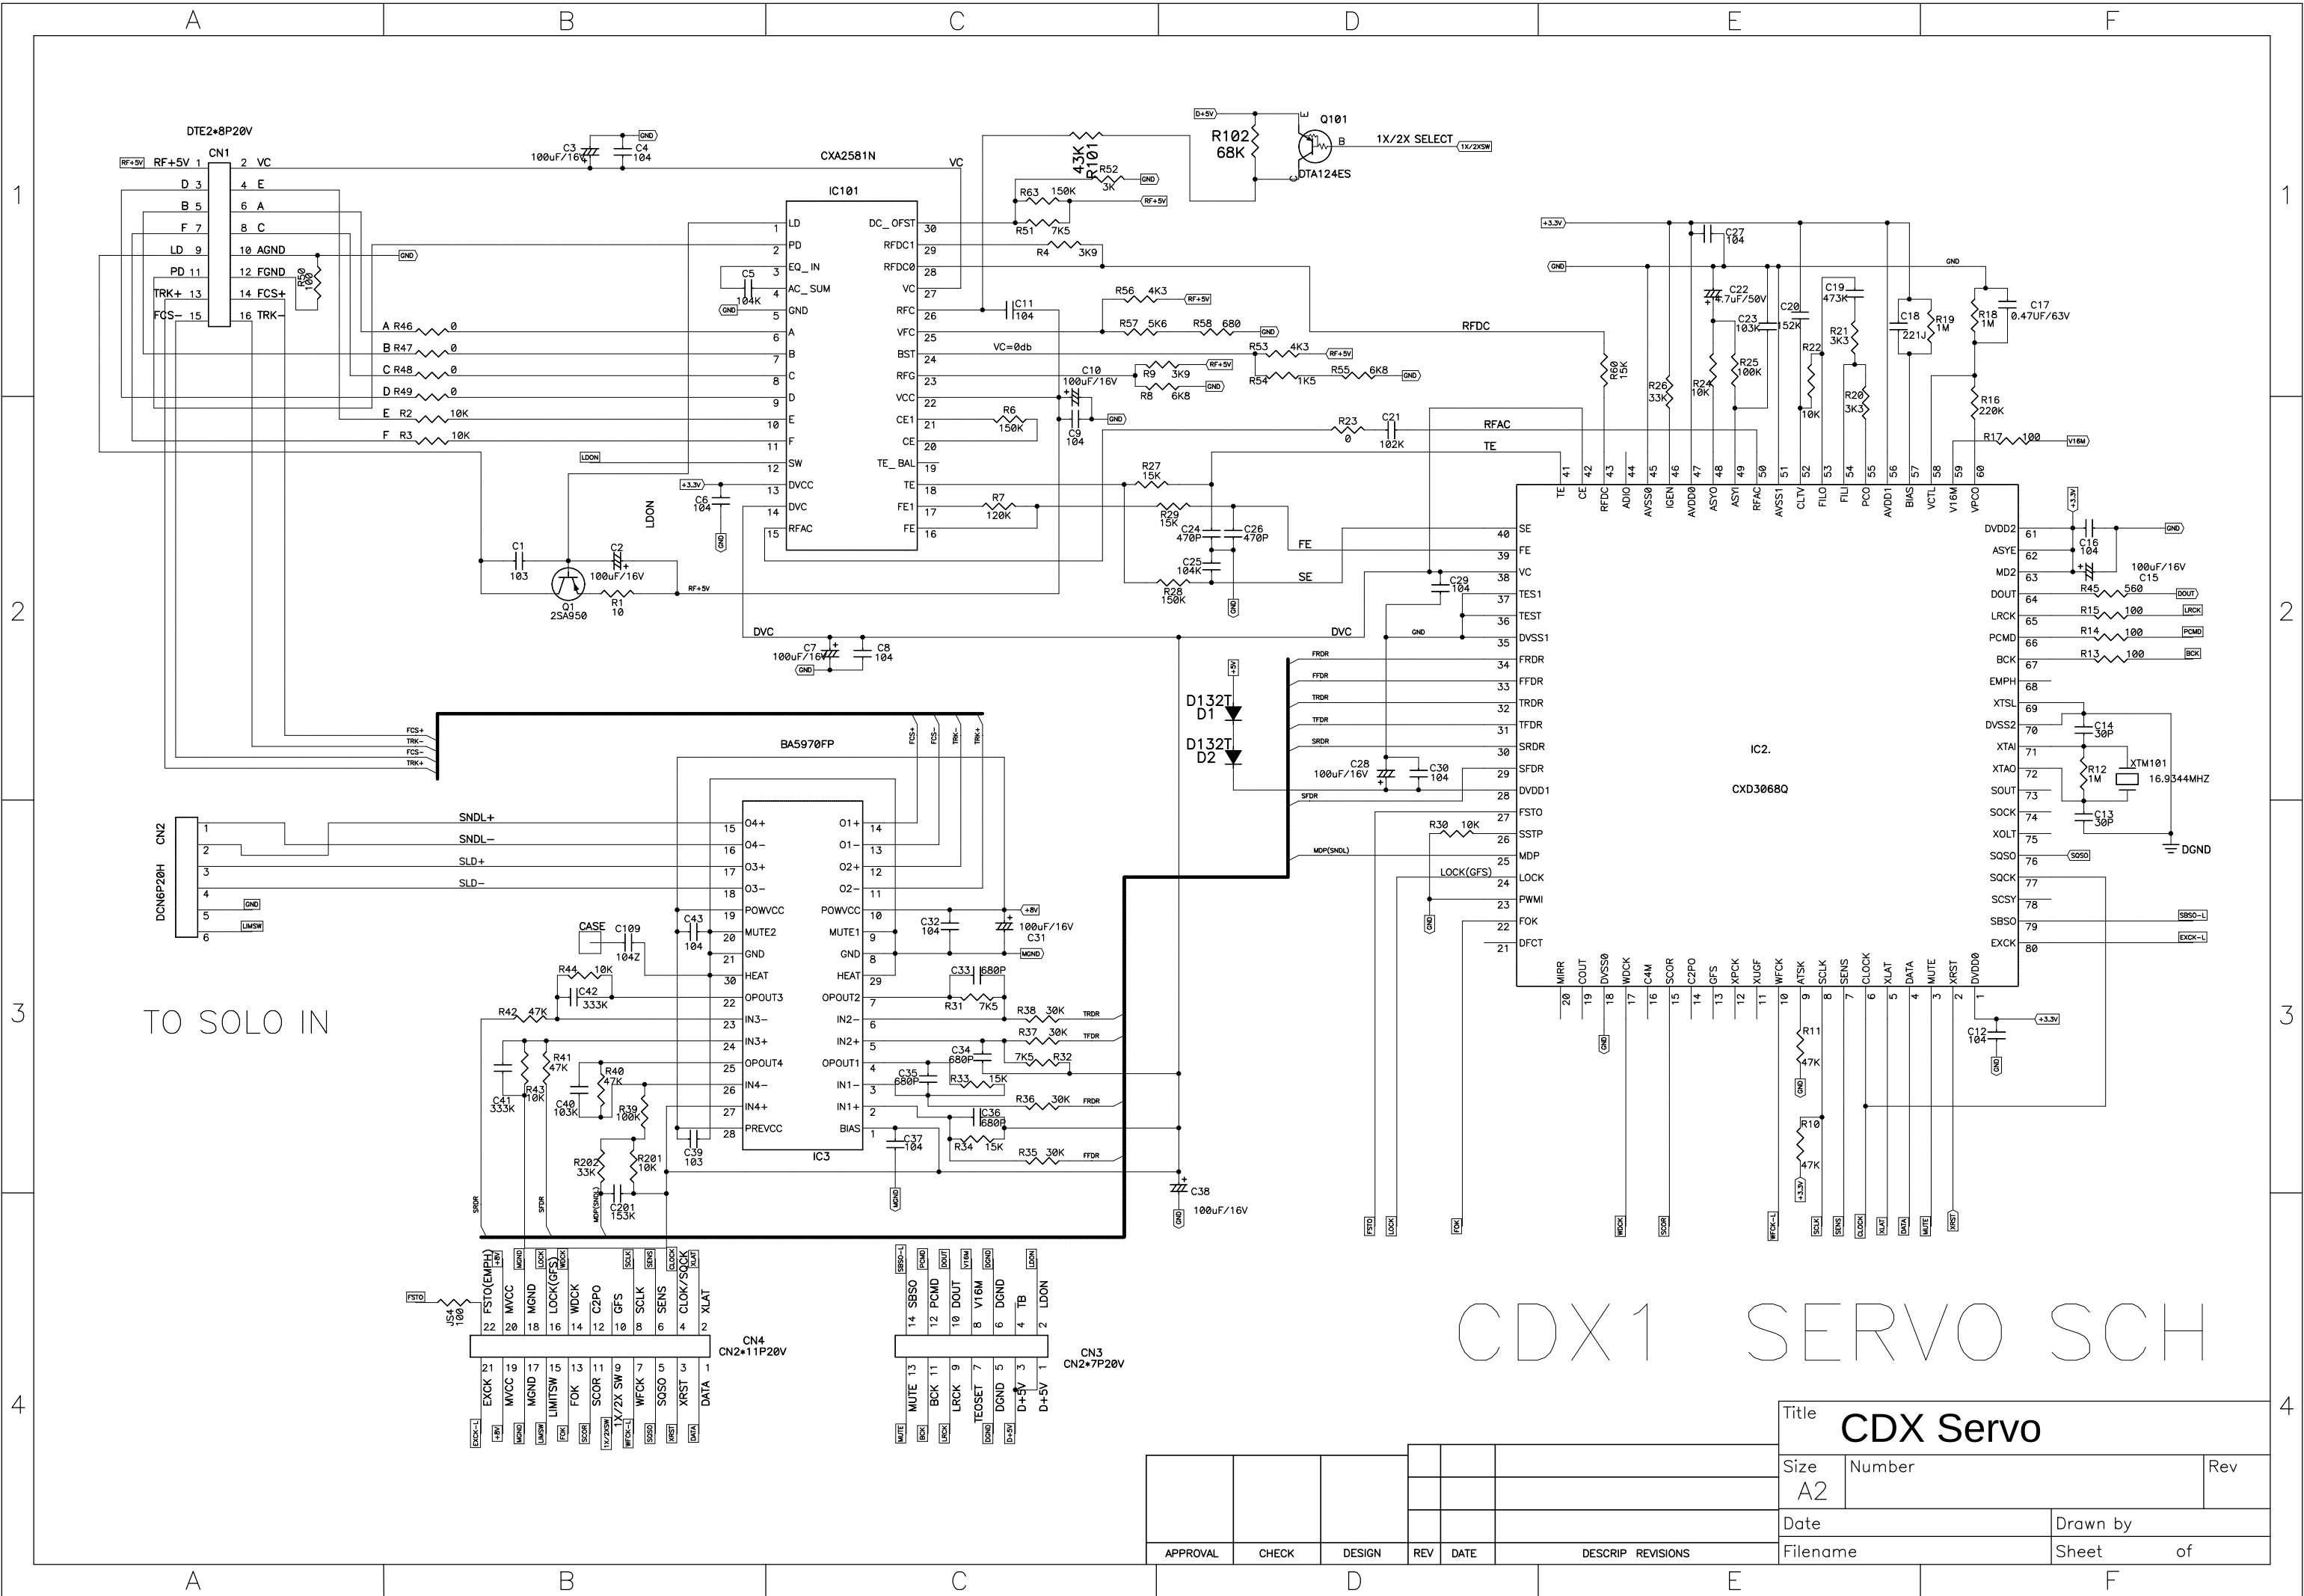

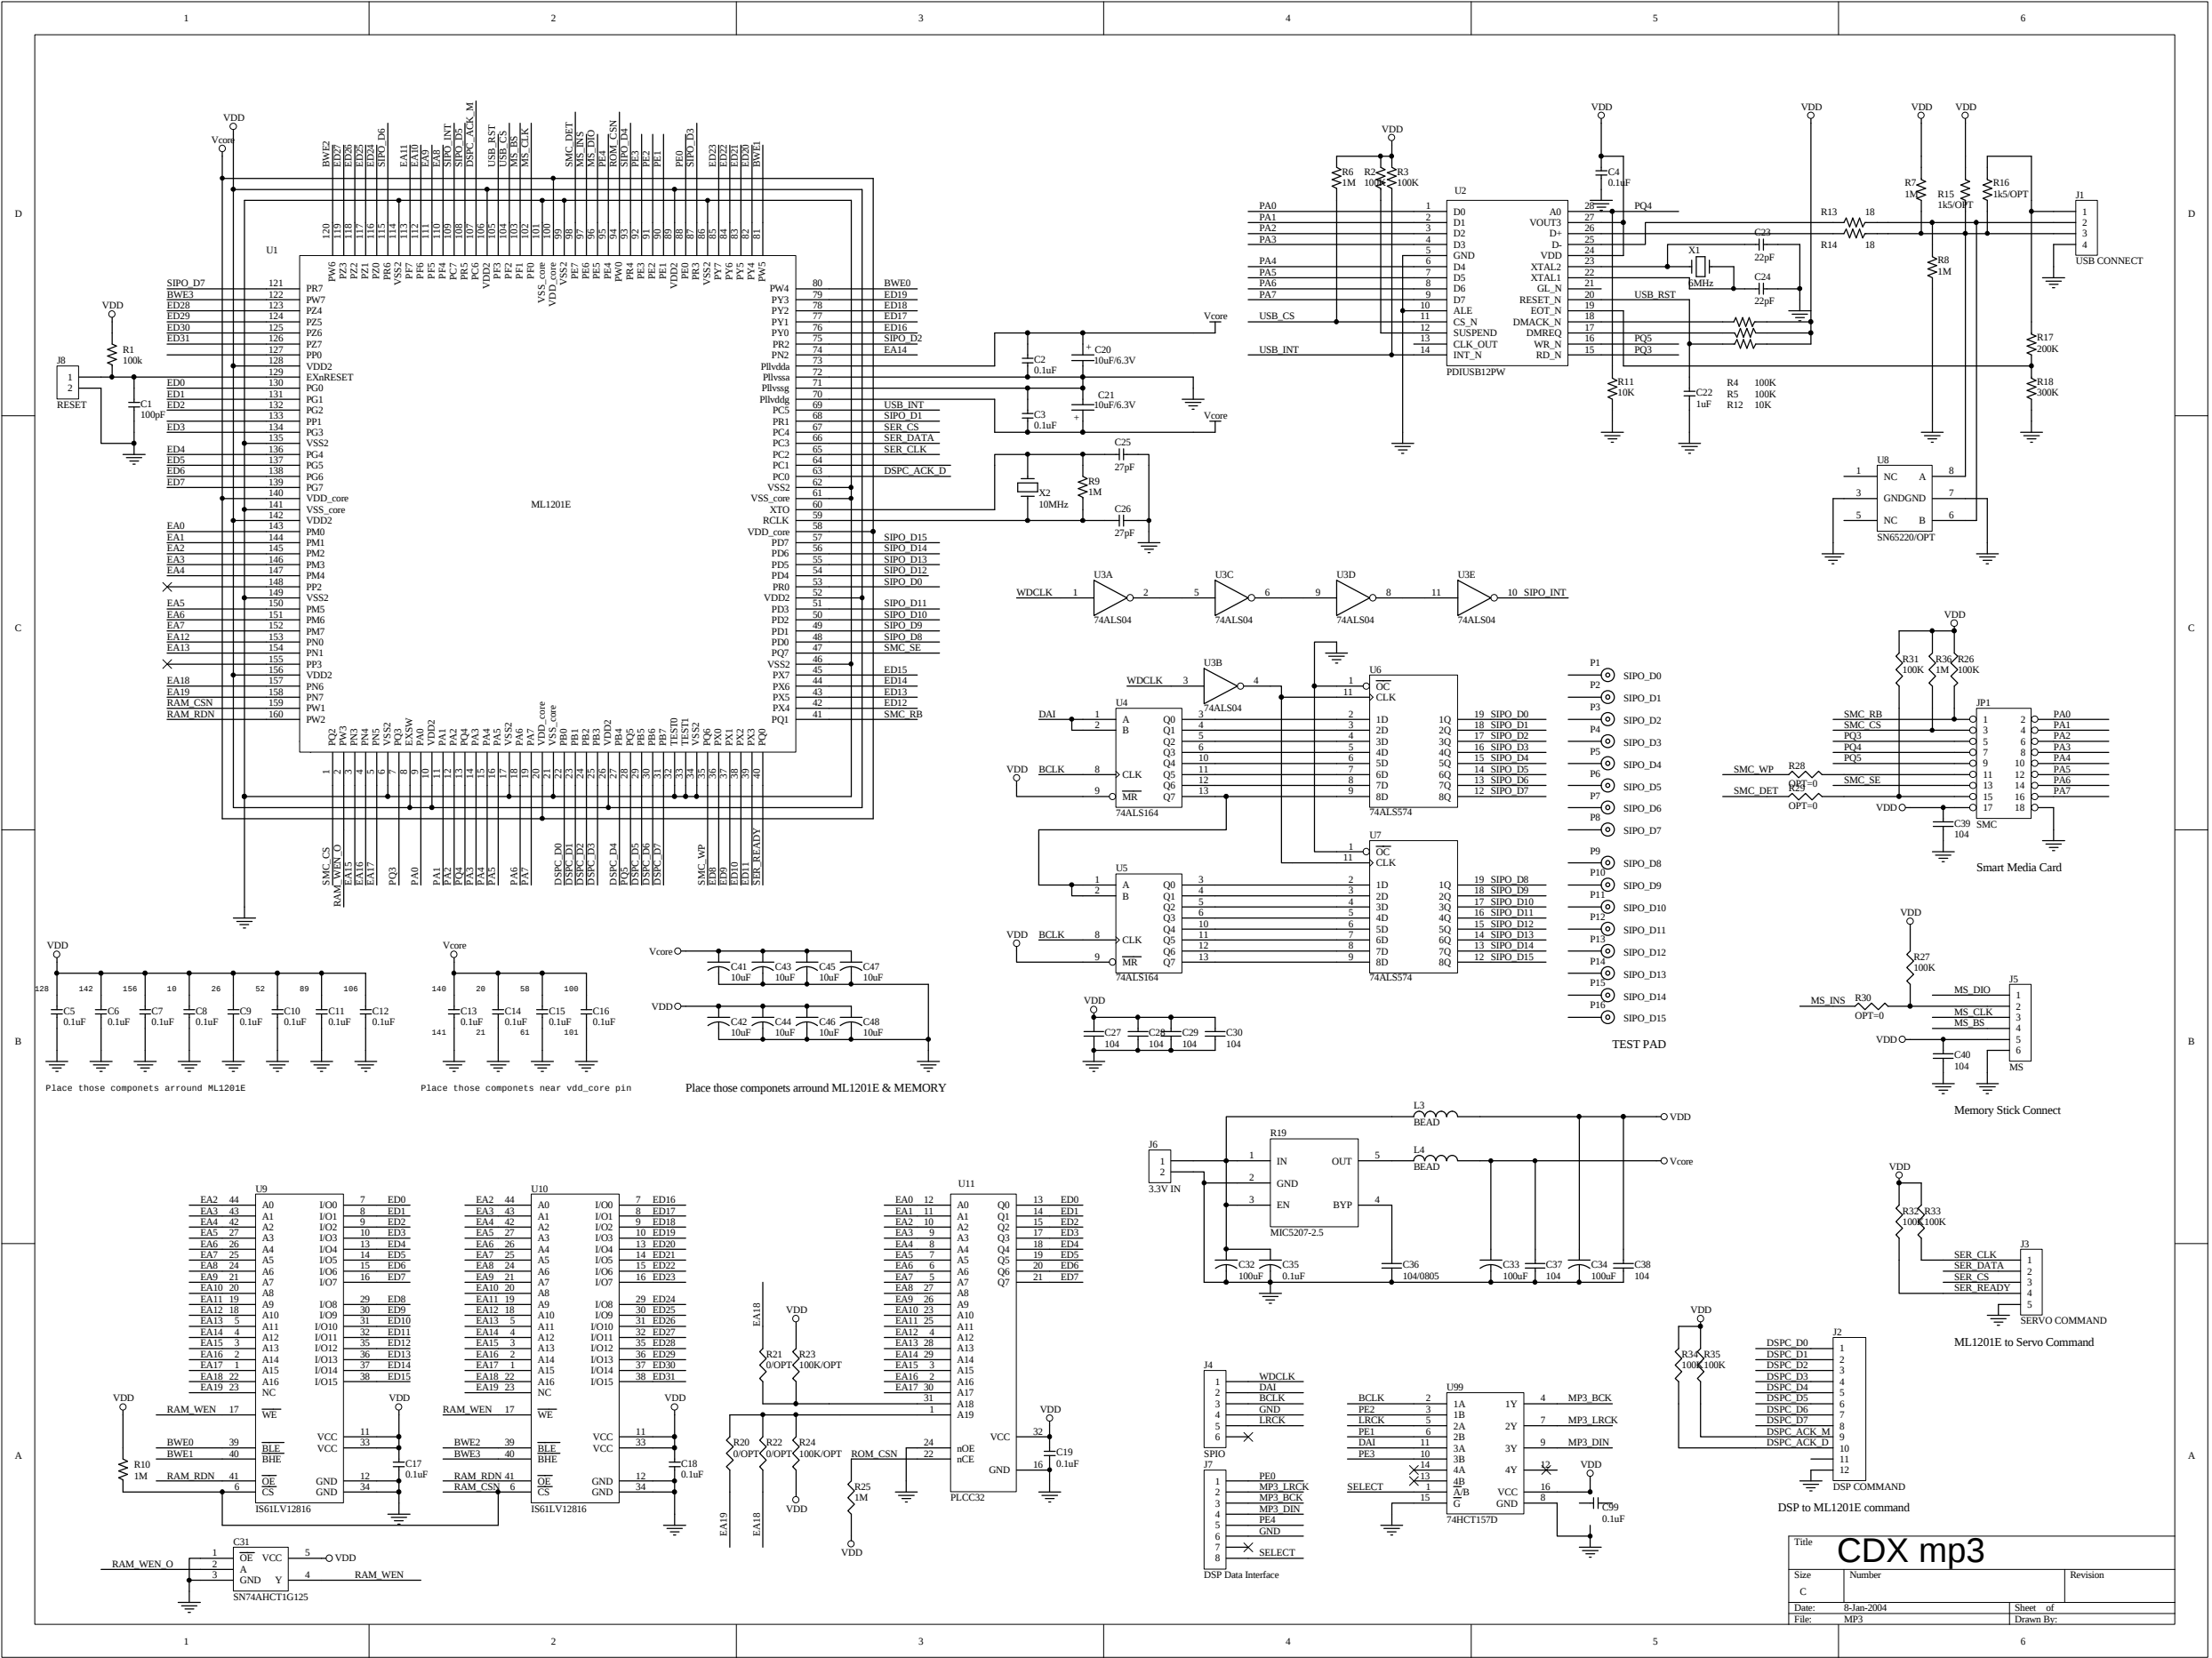

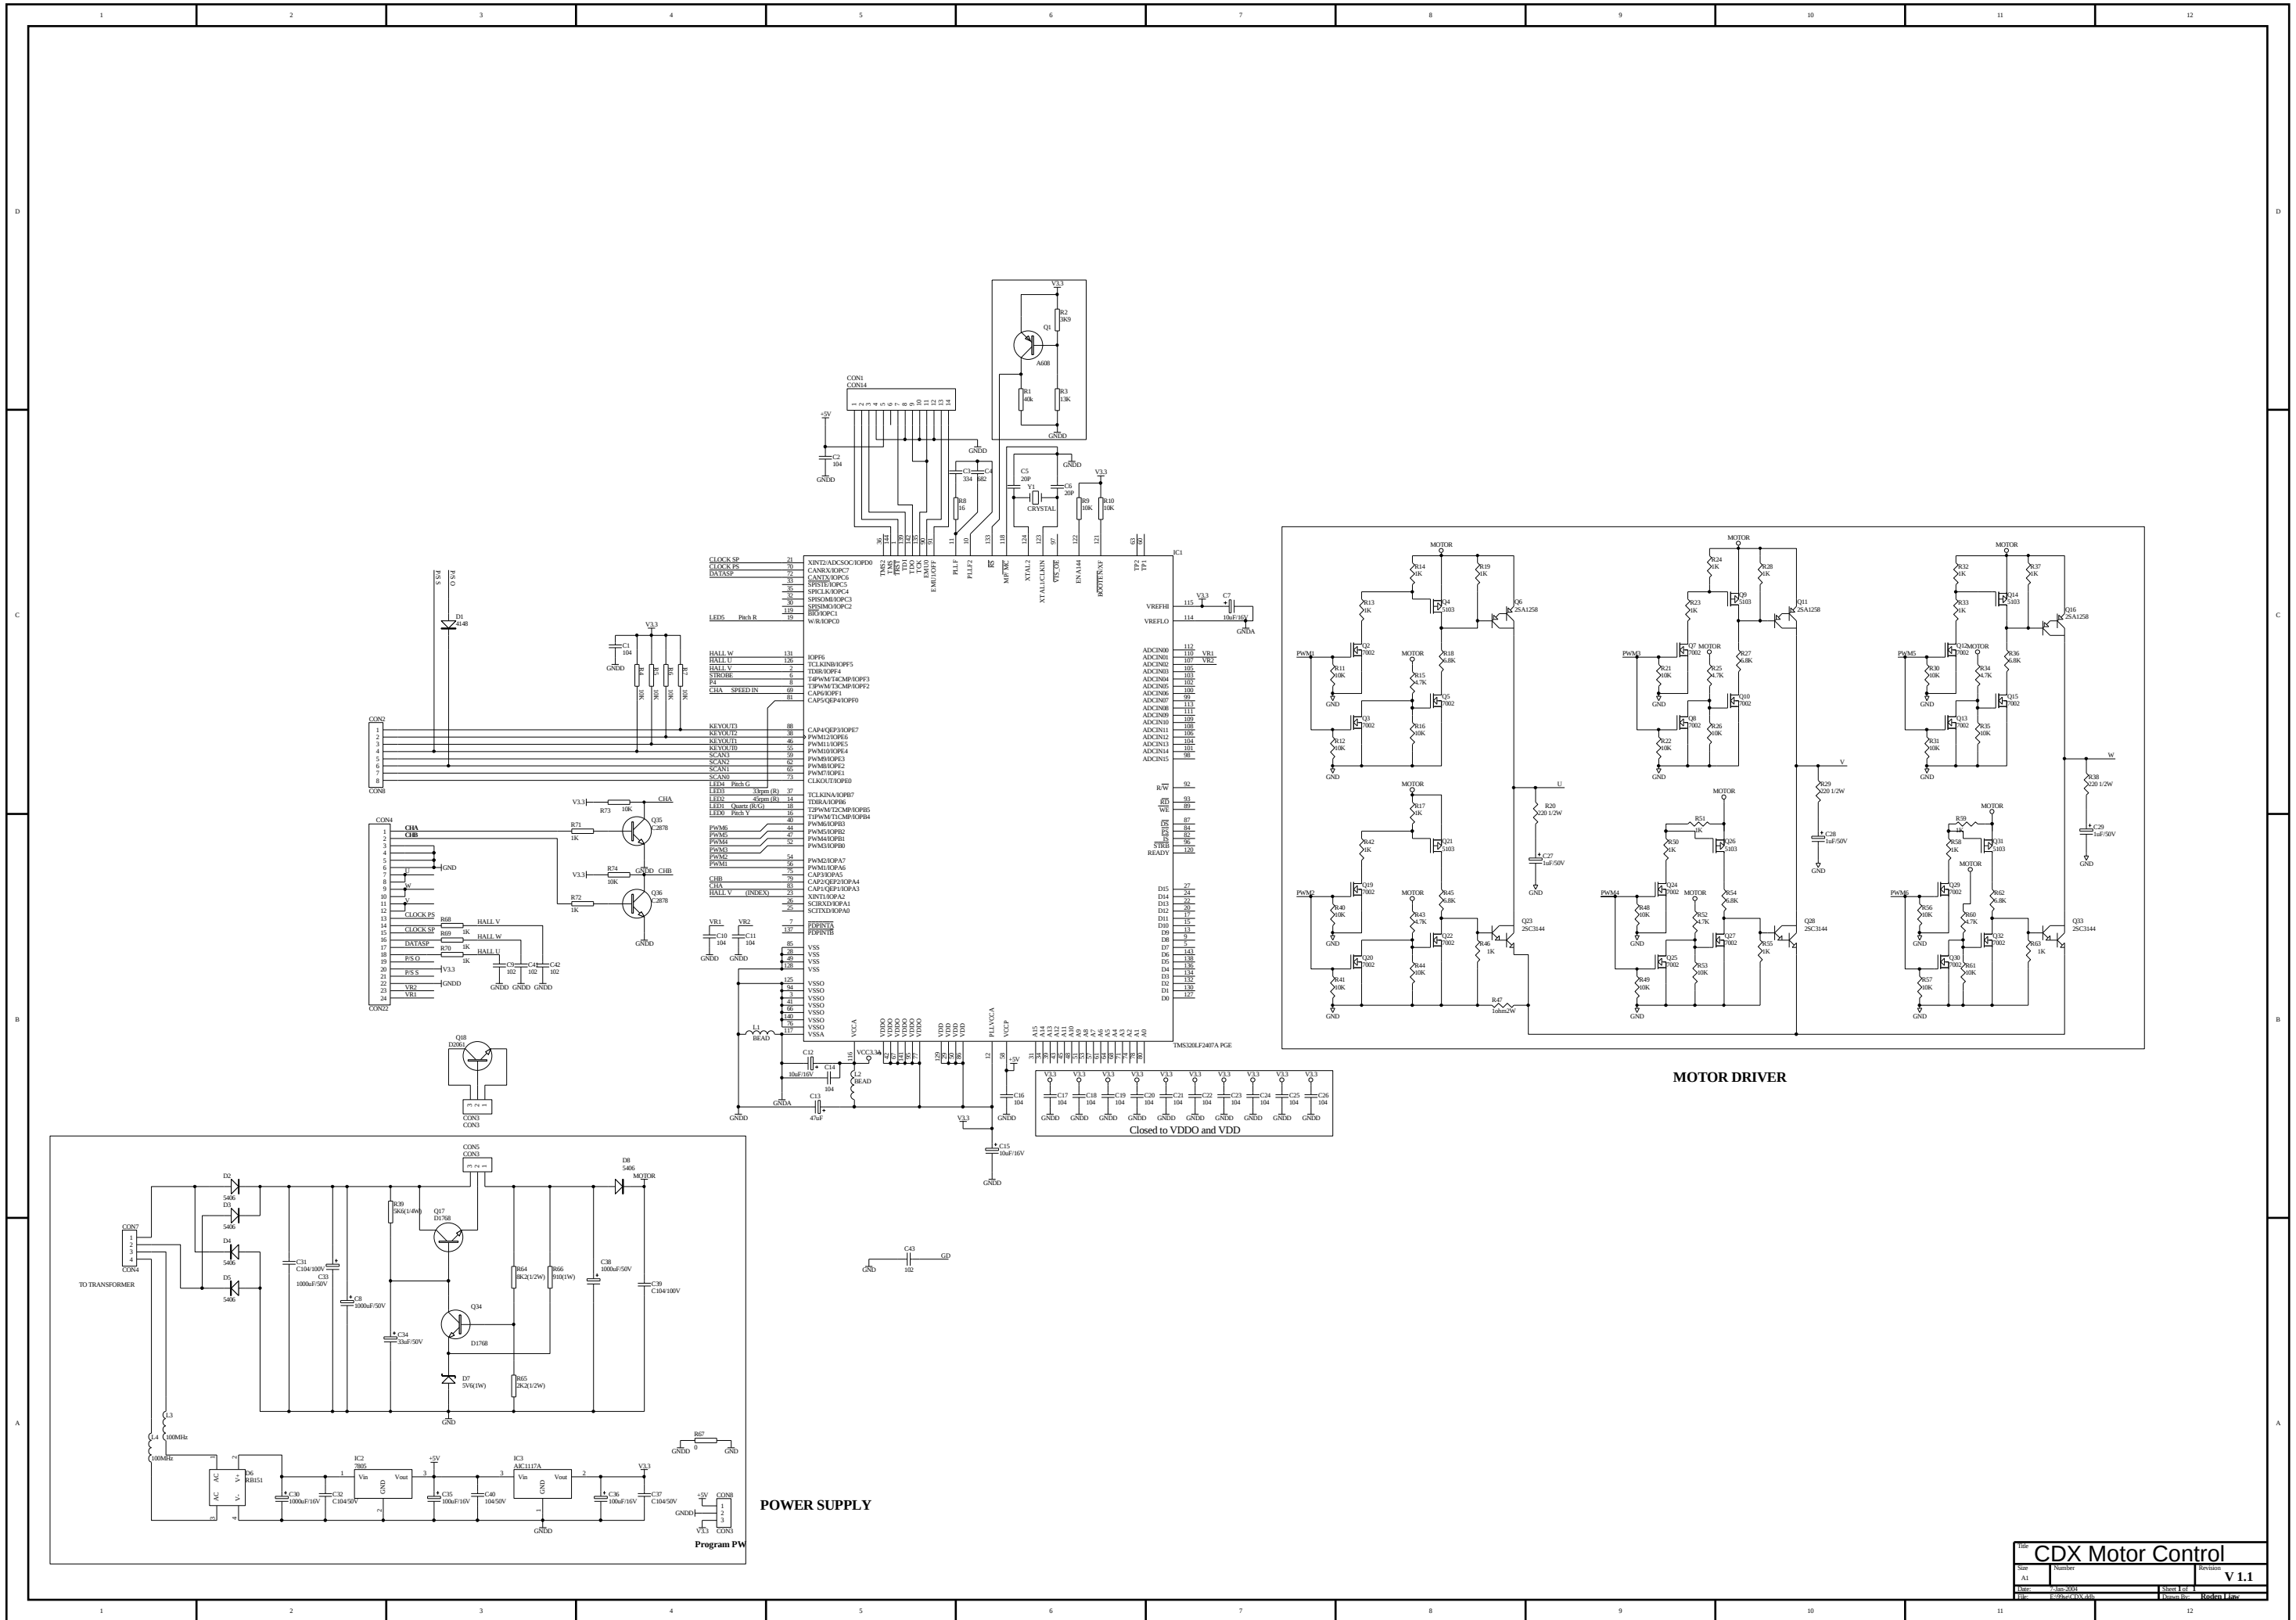

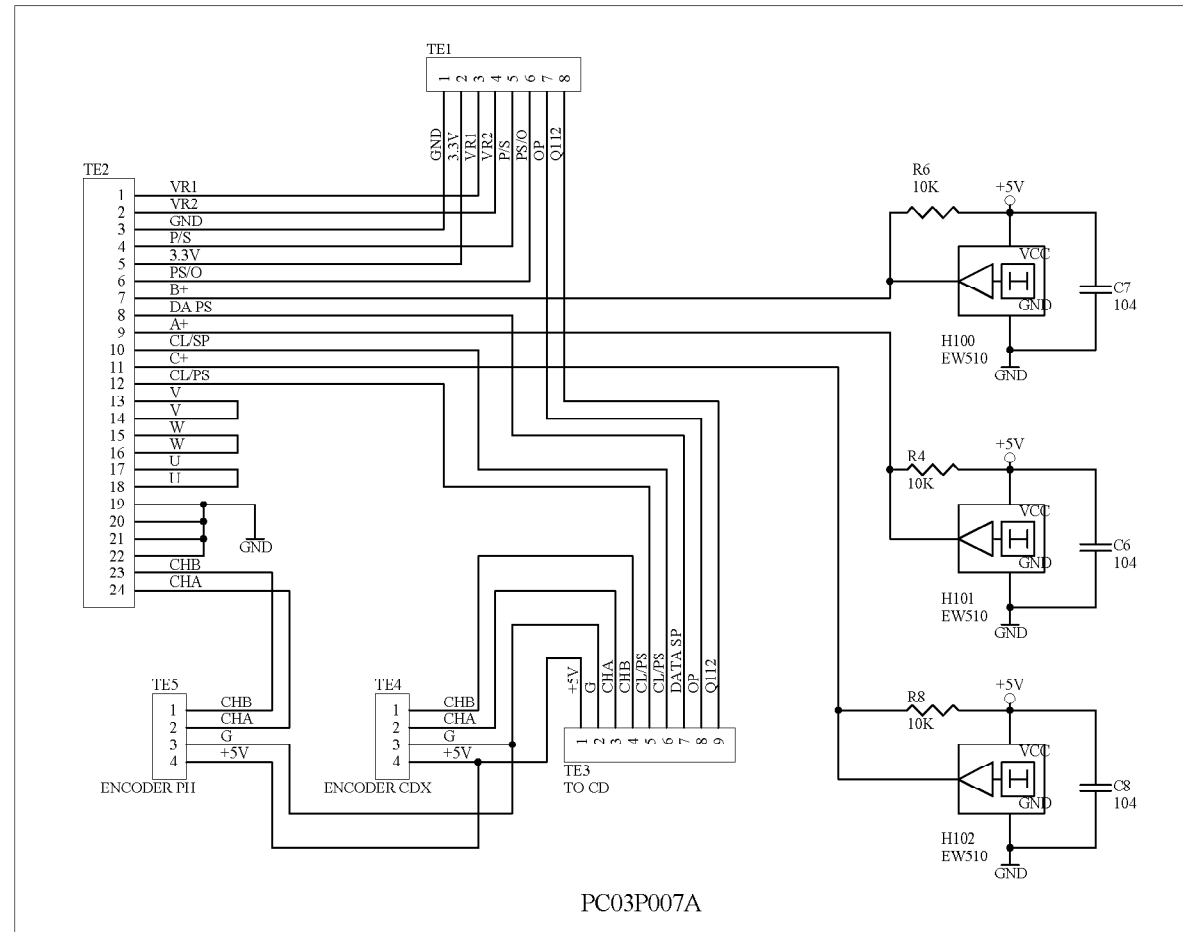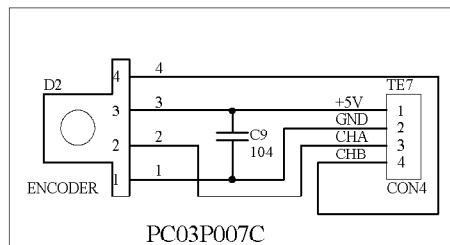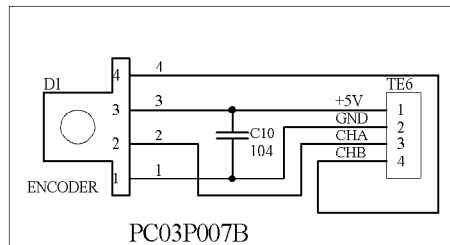

Title		
CDX Motor		
Size	Number	Revision
A4		
Date:	15-Jan-2004	Sheet of
File:		Drawn By:

Numark CDX Service Notes.

<u>TWPC03C029A01</u>	<u>PCB Assy, Main</u>
<u>TWPC04C00801</u>	<u>PCB Assy, Transport Bay Interface</u>
<u>FFC3212501001</u>	<u>Cable, Flat 32P, T/Bay-Main PCB</u>
The 32 way cable connecting the transport bay interface PCB to the main PCB, has been changed along with the connectors on these 2 boards. This was introduced to improve reliability.	
Effective in production from serial No: (21)N10407551103631	
July 2004	

<u>TWPC03P006A01</u>	<u>PCB Assy, Motor Control</u>
ECN:NE23801	
Change R13,R23,R33,R42,R50 and R58 from 1K ohm to 3.9K ohm.	
This change was introduced to reduce possible failures of Mosfets Q4,Q9,Q14,Q21,Q26 and Q39 (IRML5103).	
ECN effective in production from serial No: (21)N10408551105081	
Aug 2004	