marantz®

Service Bulletin

No. : MZ07-033
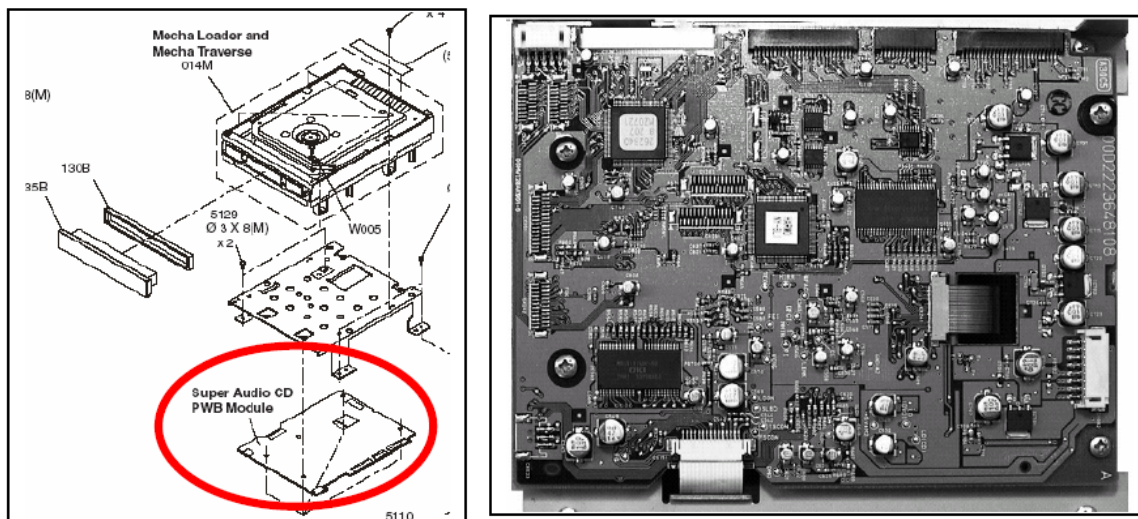**Date:** May 19, 2008

_____

Model: SA11S1, SA15S1, SA8001

Subject: "Can't Play" is displayed on LCD.

Symptom: During playback a Super Audio CD, "**Can't Play**" is displayed on LCD.
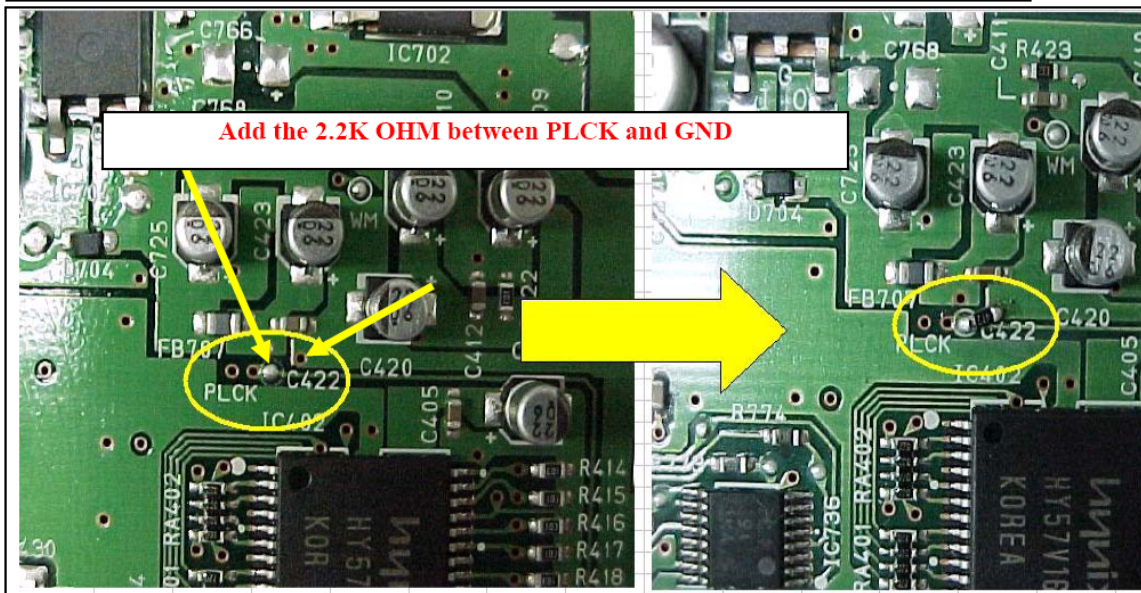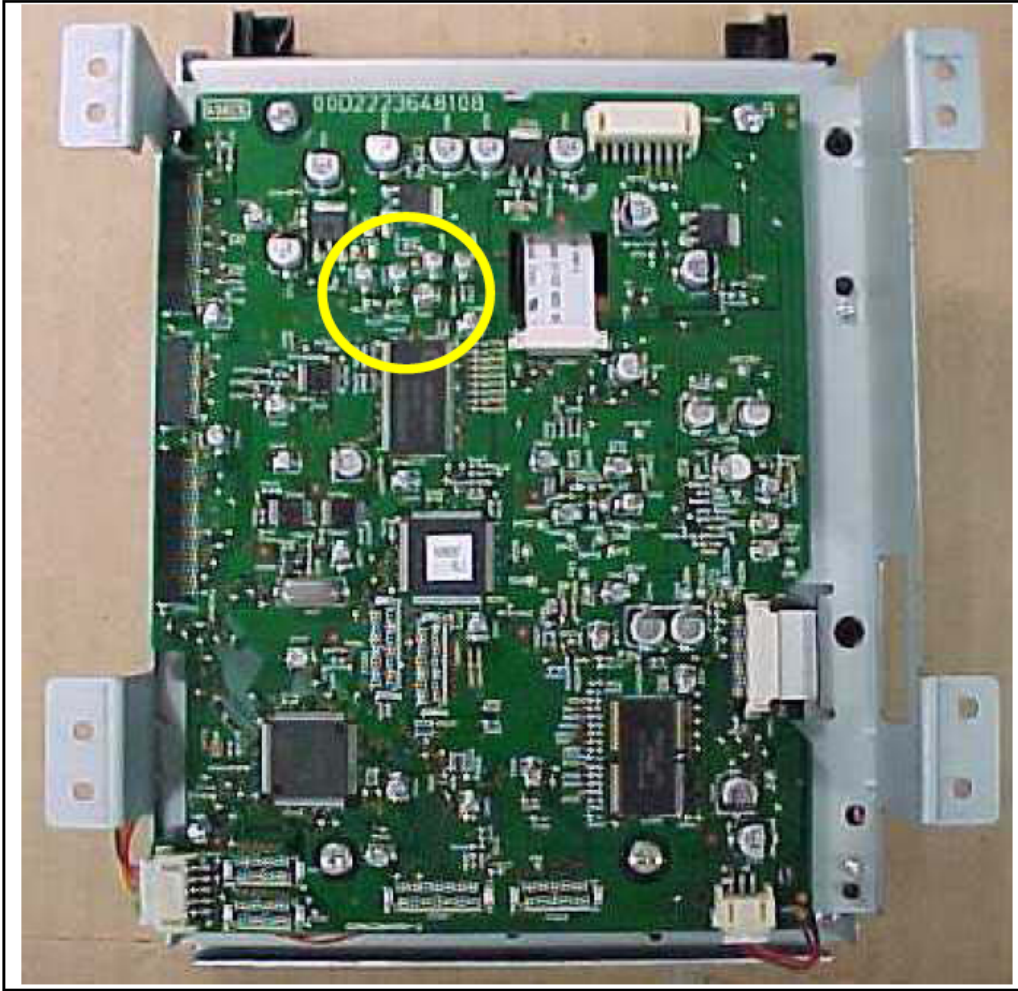
Solution: Mount 2.2K OHM on the Super Audio CD PWB Module where indicated.

Mount POS.NO. R410 2.2K OHM (PART NO. 00D2472008926) onto the Super Audio CD PWB Module.

_____

Add the 2.2K OHM between PLCK and GND

_____

CONFIDENTIALITY NOTICE:

Parts:

Ref#	Description	Part Number
R410	2.2K OHM	00D2472008926

Serial Number Range:

SA11S1 applies to 20010635000700 and earlier.
This improvement has been done in production from serial number 20010635000701 and after.

SA15S1 applies to 20000612000250 and earlier.
This improvement has been done in the production serial number 20000612000251 and after.

SA8001 applies to 01000639000593 and earlier.
This improvement has been done in the production serial number 01000639000594 and after.