marantz®

Service Bulletin

No. : MZ09-042
Date: August 27, 2009

_____

Model: SR8002/7002

Subject: Change of supplied Remote Controller
* This Service Bulletin is only service information for the following minor improvement. This is <u>not</u> a call requiring a rework to be applied to stock units.

Symptom: The supplied Remote controller for SR8002/SR7002 will be discontinuing production soon. Therefore, we will supply a new Remote controller RC3001 from next production.

Solution: 1. Detail of the production of SR8002/SR7002
1-1. When the stock of attached remote control (RC8002SR) that exists in Factory ends, it changes to RC3001.
1-2. As for RC3001, making the operation equal with the RC8002SR can be done by changing Firmware.
1-3. Operation interchangeability table (Addendum Sheet) of RC8002SR and RC3001 is bundled. (Refer to attached detailed paper)
1-4. To identify it with Carton Box, identification Label is put on the upper part of Shipping Label. (Refer to attached detailed paper)

2. Modification of RC3001 for SR8002/SR7002
When you exchange the original RC3001, you have to update the firmware of new RC3001 with flysheet.
Writer software: "**Wizz it 3**"
Firmware: "**Firmware Default Configuration_SR7002-8002.mcf**"
Service Parts: "**90M-ZK000760R**" (Unit Kit REMOTE CONTROLLER RC3001)

How to confirm the new firmware of RC3001?

1. Press the ①button, and select from "Home" mode to "AMP" mode.

_____

2. Press the "Page Scroll" ② button and choose the page to 006/009.

_____

3. Please confirm that the Programmable soft button will be assigning the "THX". (The Programmable soft button will be assigning the "RE-EQ" if the firmware of RC3001 is not updating.)
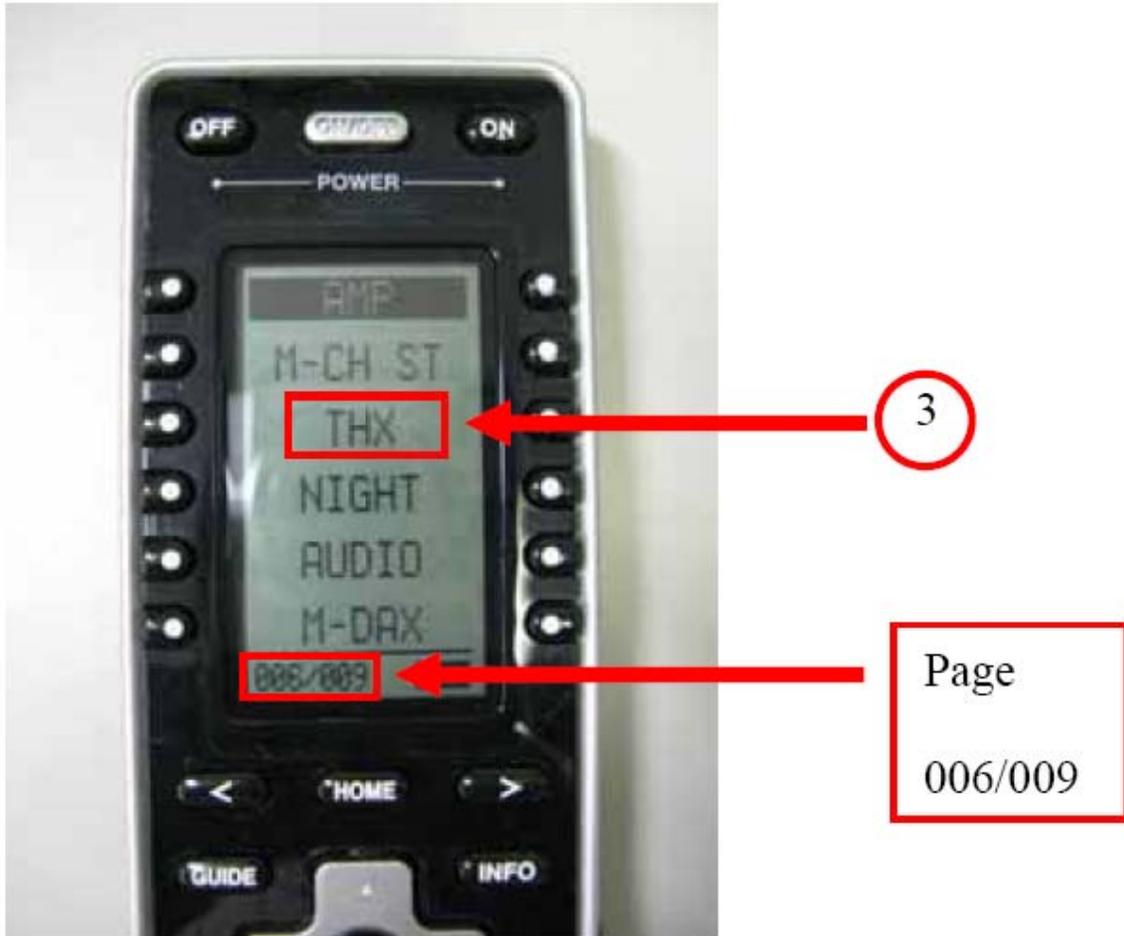
Page

006/009

4. Press the "Home" ④ button. RC3001 will be hanging to the Home mode.