

SERVICE TECHNICAL INFORMATION


ONE POINT REPAIR

UTSUNOMIYA, September 30, 1994

REF. NO. : SI-94-024

SERVICE ENGINEERING DIV.

- MODEL : NSX-340
SYSTEM 727 U
- SUBJECT : Noise occurs when the power is turned off.
- SYMPTOM : A humming sound is heard from the speaker about 5 seconds after the power is turned off. This happens only when the power is turned off immediately after switching from the CD function to another mode while the T-BASS is on.
- REMEDY : Add the circuit described below so that muting starts immediately after the power is turned off.

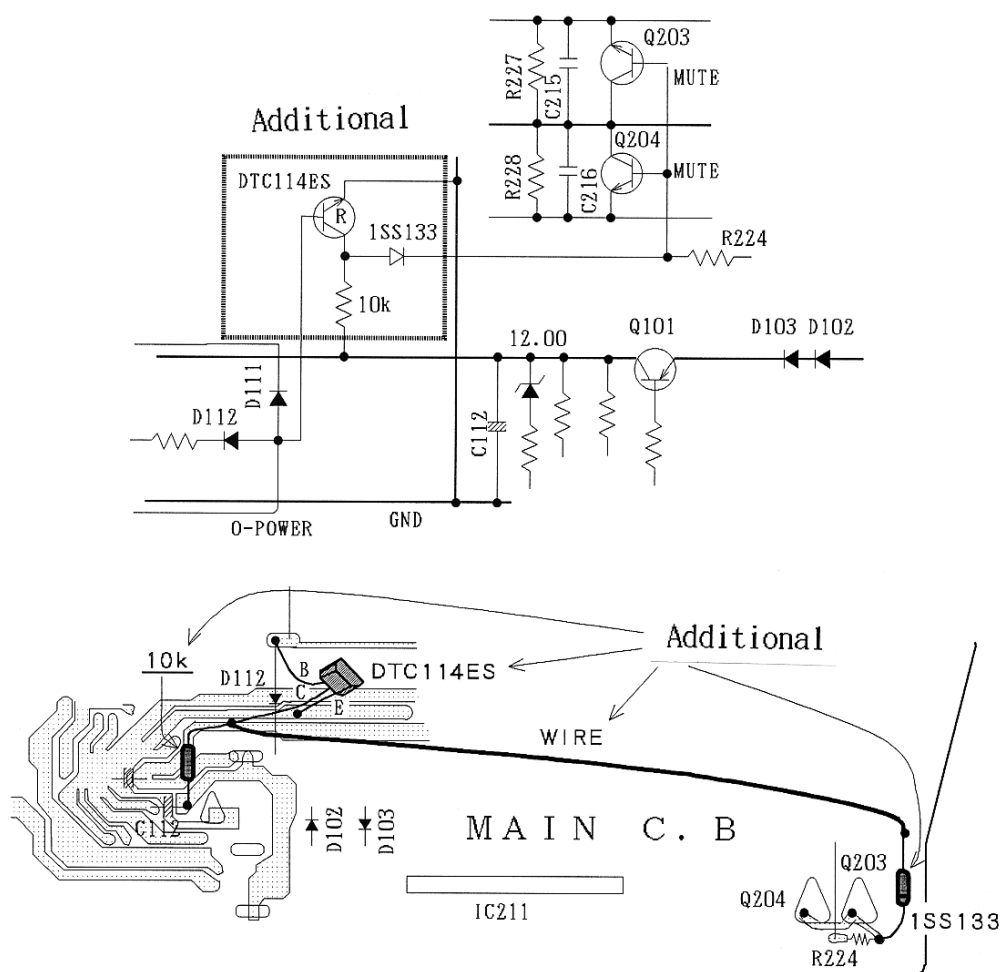

Affix supplementary parts on the circuit board with adhesive.

Ref.	Part Name	Part Number
—	TR. DTC114ES	87-026-245-010
—	DIODE, 1SS133	87-020-465-080
—	RESISTOR, 1/8W-10K	88-121-103-010
—	WIRE UB5-14-3	89-935-140-110