




Service Bulletin
No. : MZ03-059
Date: December 13, 2006

Model: CC4300 / PMD371


Subject: Incorrect operation with the Remote controller.

Symptom: "AMP Discrete power ON/ OFF" code is received, then the unit goes to Power ON/Standby mode. (16 12 01/16 12 02 code)

Solution: Replace MICRO PROCESSOR IC101 on the MAIN PCB.
First please check the version of IC101. The version number can be confirmed using SERVICE MODE. Refer to page 1 of the service manual.

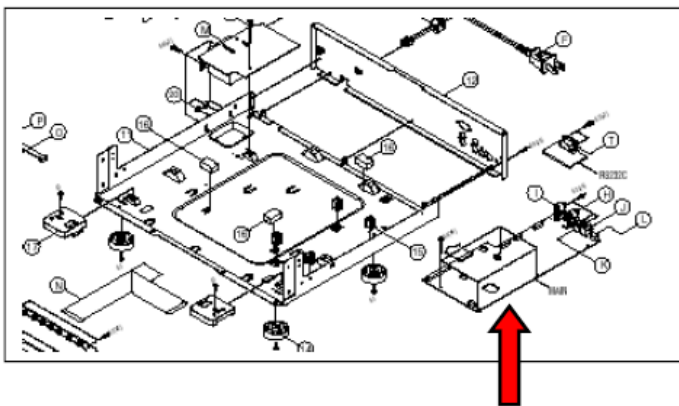

IC101 is this side of MAIN PCB

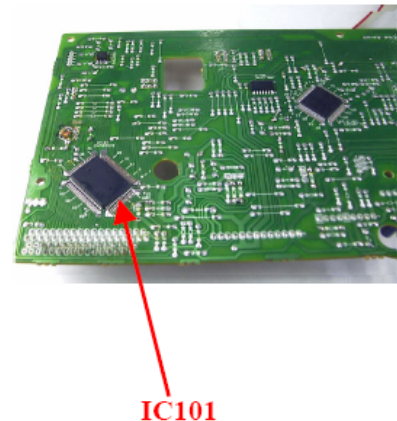

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
IC101	MICRO PROCESSOR	*HU100590R	MICRO PROCESSOR	*HU100710R

Serial Number Range:

This solution applies to the following Lot number. MZxxxxxx01xxxx to
MZxxxxxx36xxxx

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.