

marantz® SERVICE BULLETIN		Date: 8-Nov-2004	Model: SA8260, SA17S1
		Page: 1 / 2	REF.NBR: MZ04-080
Level		Application:	
★ ★		See below	
		Int.ref:	

[PHENOMENON]

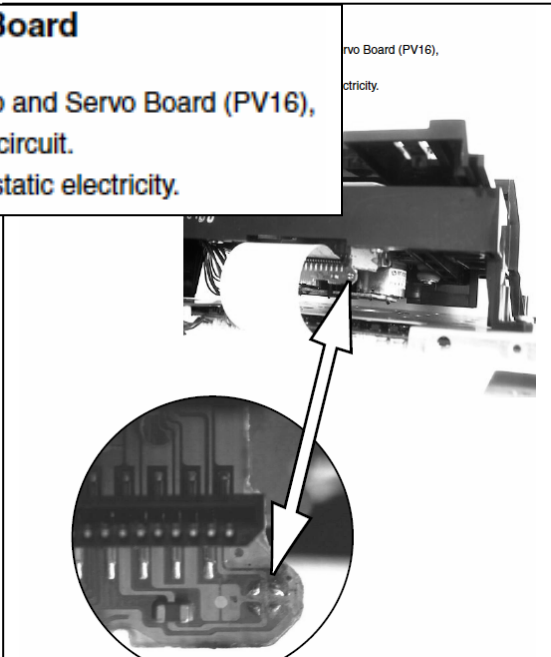
1. Can not playback Super Audio CD (low reflection DISC), "ERROR" is indicated on the display of the Unit.
2. Can not read TOC of low reflection DISC. The unit stops during playback Super Audio CD.

[SOLUTION]

In order to keep HF level, about 2mA to 5mA of laser current is increased.

1. CHIP RESISTOR (**330 OHM**) is added to Laser pickup PCB.

Please see the Service manual page 4

<p>4. CAUTION Optical pick up and Servo Board</p> <p>When removing the flat wire between Optical pick up and Servo Board (PV16), Solder the four lands pointed by arrows to short the circuit. Otherwise the LASER DIODE may be damaged by static electricity.</p>	
---	---

[NECESSARY PART]

00MNI05331110 (CHIP RESISTOR 330 OHM +5% 1/10W)

[REMARKS]

1. This problem apply to the following week code.

SA8260 / SA17S1 apply to xxxx0448xxxxxx.

2. This improvement has been done in the production week code xxxx0449xxxxxx and after.

Approved by **N.Sensui** Written by **S.NAGAO**

