

marantz[®]

Service Bulletin

No. : MZ02-032

Date: March 7, 2007

Model: SR5200/SR6200/SR7200

Subject: Pop noise

Symptom: A pop noise appears when you stop playing or skip tracks on CD playback when using a Digital connection. Pop noise appears when the Main volume is changed 74dB to 75dB (Mute).

Solution: Please apply the modifications as outlined in the following pages.

Caution: Modifications are different depending on the version of the P.C. Board. Please confirm the version of the P.C. Board before performing any updates.


*Version 1 P.C. Board (7020 06076 001-0): Please apply the modification mentioned on Pages 2 to 4.

* Version 2 P.C. Board (7020 06076 001-3): Please apply the modification mentioned on Pages 5 to 6.

CONFIDENTIALITY NOTICE:



The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

* Version 1 P.C.Board (7020 06076 001-0) : Please apply the modification mentioned below (Page2 to 4).

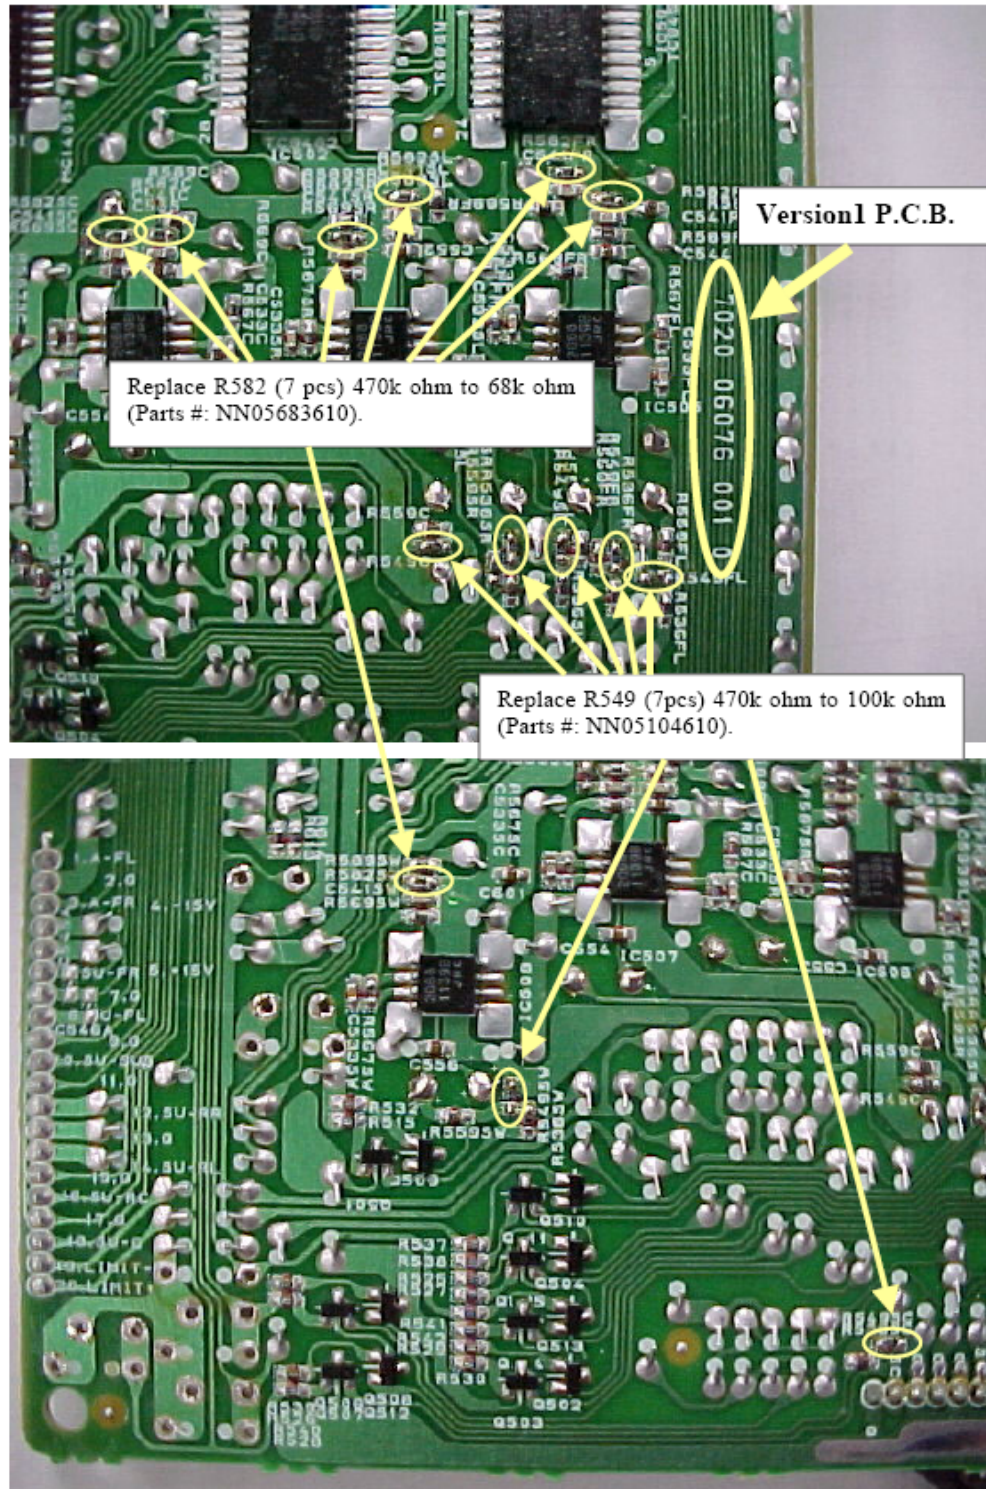


CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

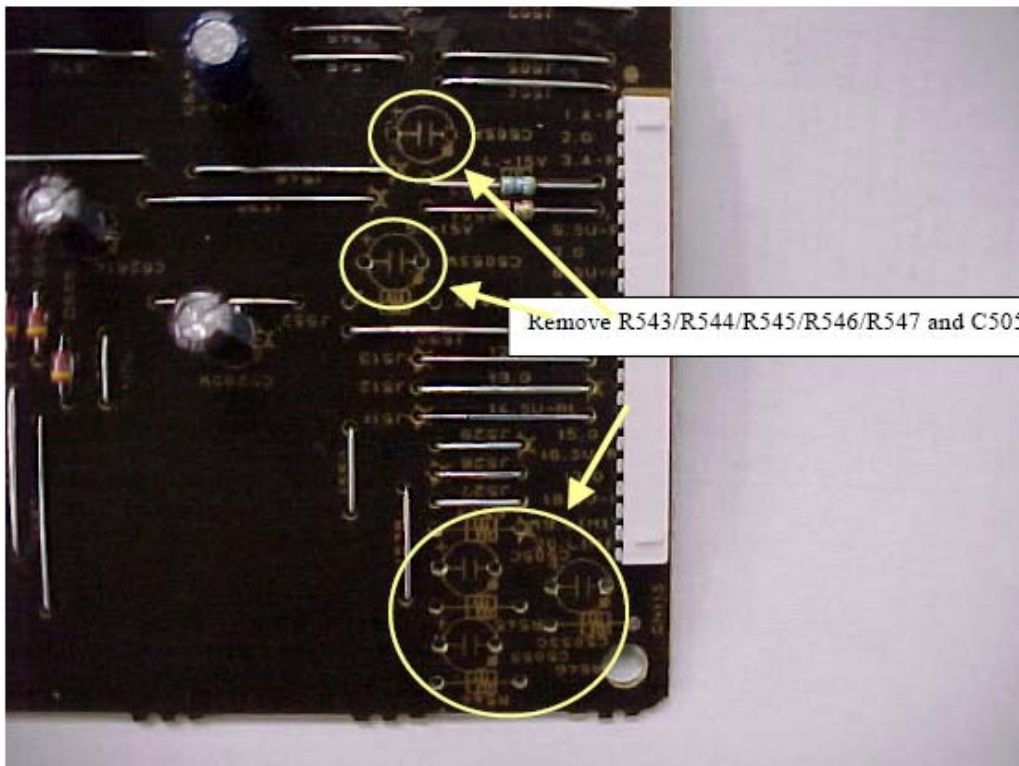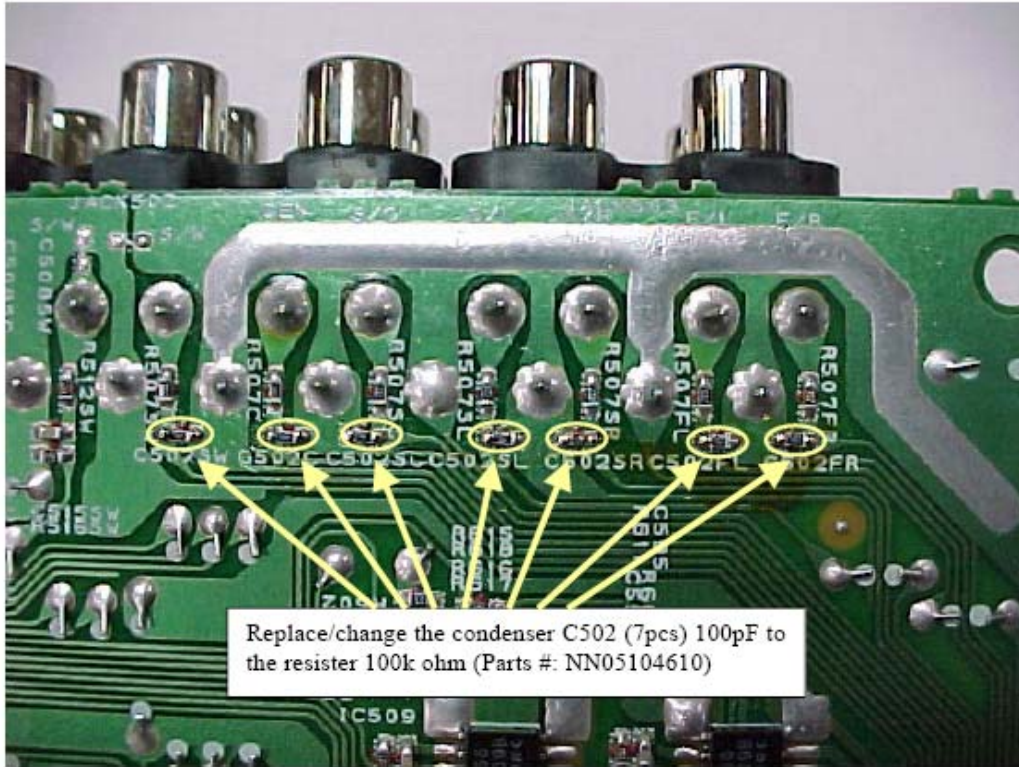

CONFIDENTIALITY NOTICE:



The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

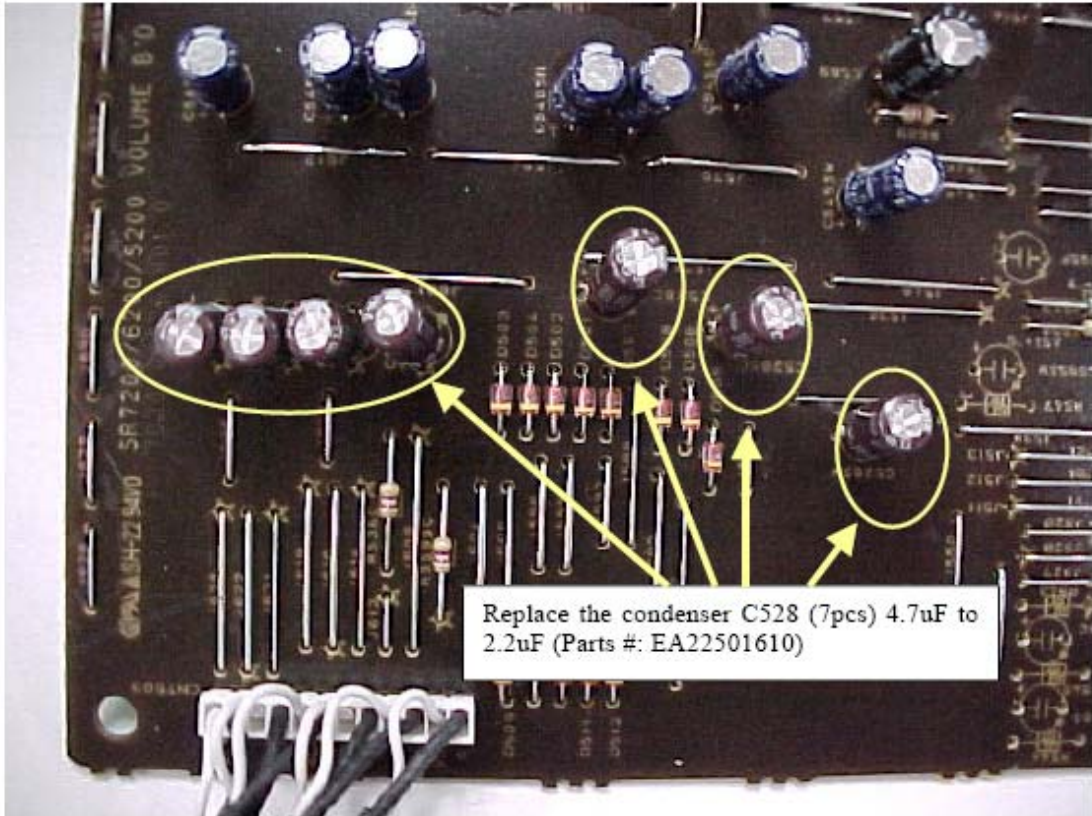

CONFIDENTIALITY NOTICE:


The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

* Version 3 P.C.Board (7020 06076 001-3) : Please apply the modification mentioned below (Page 5 to 6).

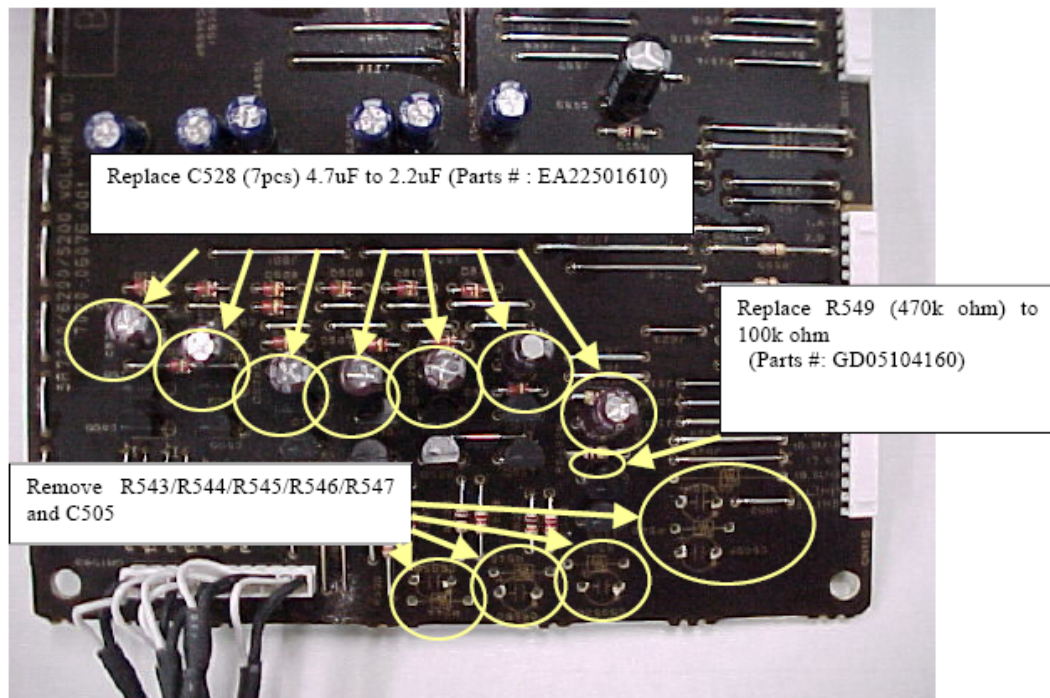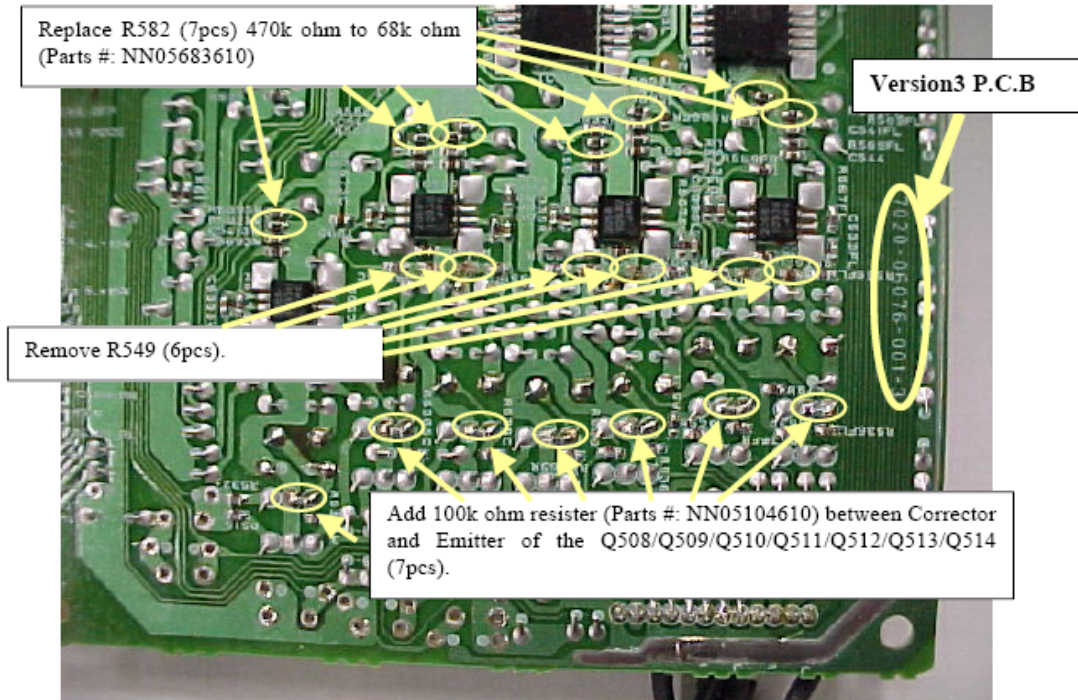

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

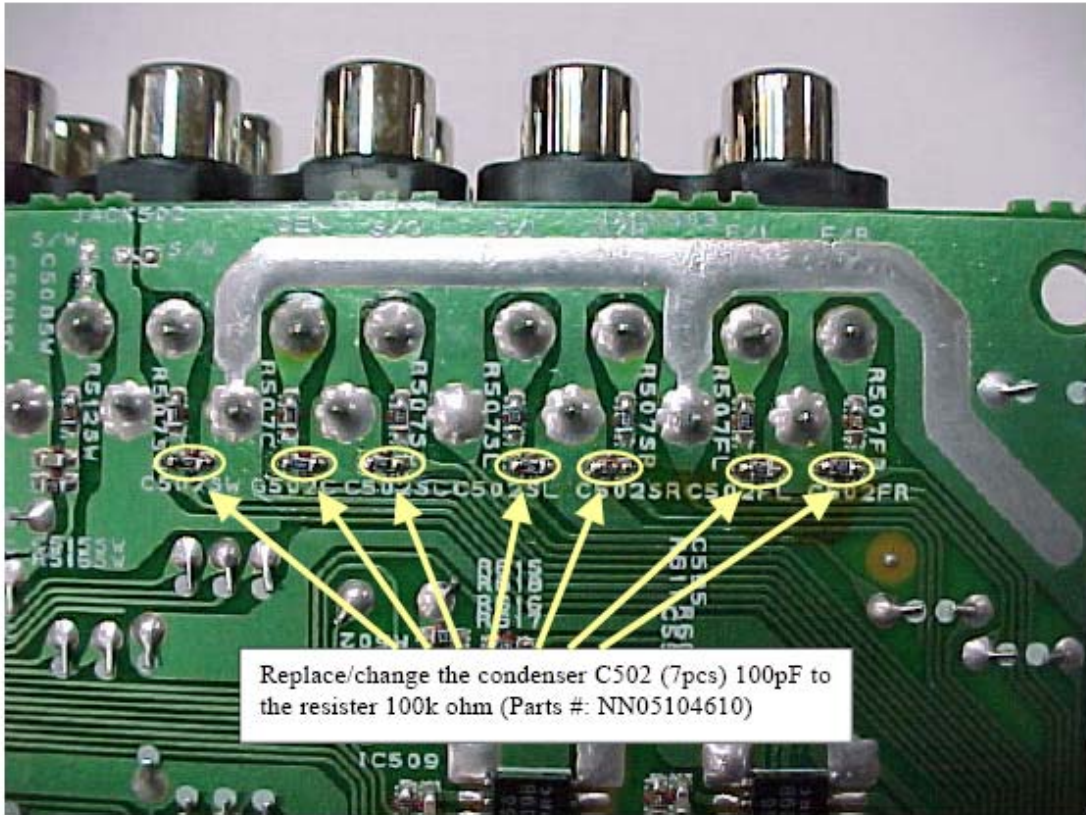

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
R582	470k ohm	NA	68k ohm	NN05683610
R549	470k ohm (surface mount)	NA	100k ohm	NN05104610
C502	100pF	NA	100k ohm	NN05104610
C528	4.7uF	NA	2.2uF	EA22501610
R549	470k ohm (through hole)	NA	100k ohm	GD05104160

Serial Number Range:

SR5200 - MZ020149003041 and after.
 SR6200 - MZ020149004311 and after.
 SR7200 - MZ010148008211 and after.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.